



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

September 19, 2022

Seat Belt Not Retracting Properly/FMVSS 208 & 209

NHTSA Campaign Number: 22V666000

Manufacturer Nissan North America, Inc.

Components SEAT BELTS

Potential Number of Units Affected 8,391

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2021-2022 Rogue vehicles. The rear seat belts for the left-hand and right-hand rear seats may not retract properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 208, "Occupant Crash Protection," and 209, "Seatbelt Assemblies."

Remedy

Dealers will inspect and replace the rear seat belts, as necessary, free of charge. Owner notification letters are expected to be mailed October 27, 2023. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's number for this recall is PC915.

Vehicle

MAKE MODEL YEAR

NISSAN ROGUE 2021-2022

Disabled ABS & Stability Control System

NHTSA Campaign Number: 22V679000

Manufacturer Mercedes-Benz USA, LLC

Components ELECTRONIC STABILITY CONTROL

Potential Number of Units Affected 4

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2021 GLB250 vehicles. The Electronic Stability Program (ESP) unit may be damaged, which can result in disabled anti-lock brakes (ABS), disabled electronic stability control (ESC), and an electrical short circuit.

Remedy

Dealers will replace the ESP unit, free of charge. Owner notification letters are expected to be mailed November 11, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicle

MAKE	MODEL YEAR
-------------	-------------------

MERCEDES-BENZ	GLB250 2021
---------------	-------------

Engine Control Unit Software May Cause Stall

NHTSA Campaign Number: 22V687000

Manufacturer Volkswagen Group of America, Inc.

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 2

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 TAOS vehicles equipped with all-wheel drive. The engine control unit (ECU) software may cause a stall when coming to a stop.

Remedy

Dealers will update the ECU software, free of charge. Owner notification letters are expected to be mailed November 11, 2022. Owners may contact Volkswagen's customer service at 1-800-893-5298. Volkswagen's number for this recall is 24iL.

Vehicle

MAKE MODEL YEAR

VOLKSWAGEN TAOS 2022

Third-Row Seat Springs Improperly Installed

NHTSA Campaign Number: 22V670000

Manufacturer BMW of North America, LLC

Components SEATS

Potential Number of Units Affected 246

Summary

BMW of North America, LLC (BMW) is recalling certain 2019-2022 BMW X7 xDrive40i, X7 Drive50i, X7 M50i vehicles with third-row seats. One or more of the compression springs that lock the backrest may not have been installed properly, and could dislodge or detach.

Remedy

Dealers will inspect the third-row seat and, if necessary, remove and reinstall improperly installed compression springs, and reinstall any missing springs, free of charge. Owner notification letters are expected to be mailed October 31, 2022. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW X7 2019-2022

Unsecured Transmission May Cause Rollaway

NHTSA Campaign Number: 22V671000

Manufacturer Nissan North America, Inc.

Components POWER TRAIN

Potential Number of Units Affected 203,223

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2020-2023 Titan and Frontier vehicles. The transmission parking pawl may not engage when the vehicle is shifted into park, which can result in a vehicle rollaway.

Remedy

Owners are advised to apply the parking brake every time they park their vehicle. A remedy plan is currently under development. Owner notification letters are expected to be mailed November 1, 2022. Owners may contact Nissan's customer service at 1-800-867-7669.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

NISSAN	FRONTIER	2020-2023
--------	----------	-----------

NISSAN	TITAN	2020-2023
--------	-------	-----------

Rear Door Window Trim Bars May Detach

NHTSA Campaign Number: 22V680000

Manufacturer Mercedes-Benz USA, LLC

Components STRUCTURE

Potential Number of Units Affected 161,000

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2020-2022 GLE350, GLE450, GLS450, 2021-2022 AMG GLE53, 2020-2021 GLE580, GLS580, and 2021 GLE400e, AMG GLS63, AMG GLE63 S, and Maybach GLS600 vehicles. Due to a manufacturing error, the rear door window trim bars may detach.

Remedy

Dealers will inspect and secure the rear window trim bars, as necessary, free of charge. Owner notification letters are expected to be mailed November 11, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG GLE53	2021-2022
MERCEDES-BENZ	AMG GLE63S	2021
MERCEDES-BENZ	AMG GLS63	2021
MERCEDES-BENZ	GLE350	2020-2022
MERCEDES-BENZ	GLE400E	2021
MERCEDES-BENZ	GLE450	2020-2022
MERCEDES-BENZ	GLE580	2020-2021

MAKE	MODEL	YEAR
MERCEDES-BENZ	GLS450	2020-2022
MERCEDES-BENZ	GLS580	2020-2021
MERCEDES-BENZ	MAYBACH GLS600	2021

Short Circuit from Moisture Accumulation in Trunk

NHTSA Campaign Number: 22V678000

Manufacturer Mercedes-Benz USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 6,752

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022 C300 vehicles. Moisture accumulation in the trunk may leak into the signal acquisition module (SAM), causing an electrical short circuit.

Remedy

Dealers will install a cover for the SAM, free of charge. Owner notification letters are expected to be mailed November 11, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicle

MAKE	MODEL	YEAR
MERCEDES-BENZ	C300	2022

Fuel Tank Vent Pipe May Be Damaged

NHTSA Campaign Number: 22V673000

Manufacturer Volkswagen Group of America, Inc.

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 13,004

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021-2022 Audi Q3 vehicles. The vent pipe within the fuel tank may have been damaged during fuel tank assembly.

Remedy

Dealers will inspect the internal vent pipe for damage and replace the charcoal canister and the fuel tank, if necessary, free of charge. Owner notification letters are expected to be mailed November 4, 2022. Owners may contact Audi's customer service at 1-800-253-2834. Volkswagen's number for this recall is 20DS.

Vehicle

MAKE MODEL YEAR

AUDI Q3 2021-2022

Improperly Installed Steering Shaft Bolt

NHTSA Campaign Number: 22V681000

Manufacturer Daimler Trucks North America, LLC

Components STEERING

Potential Number of Units Affected 202

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022-2023 Western Star 49X and 47X vehicles. The u-joint pinch bolt on the steering shaft may detach, which can cause a loss of steering control.

Remedy

Dealers will inspect and repair the joint, as necessary, free of charge. Owner notification letters are expected to be mailed November 11, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL952.

Vehicles

MAKE MODEL YEAR

WESTERN STAR 47X 2022-2023

WESTERN STAR 49X 2022-2023