



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

September 5, 2022

Rearview Camera Image May Not Display/FMVSS 111

NHTSA Campaign Number: 22V638000

Manufacturer Chrysler (FCA US, LLC)

Components BACK OVER PREVENTION

Potential Number of Units Affected 7,895

Summary

Chrysler (FCA US, LLC) is recalling certain 2020-2021 Jeep Wrangler, RAM 1500 and 2021 Jeep Gladiator vehicles. A radio software error may prevent the rearview image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the radio software, free of charge. Owner notification letters are expected to be mailed October 14, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA, LLC's number for this recall is Z86.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

JEEP	GLADIATOR	2021
------	-----------	------

JEEP	WRANGLER	2020-2021
------	----------	-----------

RAM	1500	2020-2021
-----	------	-----------

Improperly Secured Front Seat Belt Anchor

NHTSA Campaign Number: 22V641000

Manufacturer Rivian Automotive, LLC

Components SEAT BELTS

Potential Number of Units Affected 207

Summary

Rivian Automotive, LLC (Rivian) is recalling certain 2022 R1T and R1S vehicles. The front seat belt anchors may have been inadequately attached to the B-pillar.

Remedy

Rivian will inspect the front seat belt assemblies and, as necessary, properly secure the bolts, free of charge. Owner notification letters are expected to be mailed October 14, 2022. Owners may contact Rivian customer service at 1-888-748-4261. Rivian's number for this recall is FSAM-924.

Vehicles

MAKE MODEL YEAR

RIVIAN R1S	2022
RIVIAN R1T	2022

Internal ECM Short May Cause Loss of Drive Power

NHTSA Campaign Number: 22V642000

Manufacturer Chrysler (FCA US, LLC)

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 4,907

Summary

Chrysler (FCA US, LLC) is recalling certain 2022 Ram 3500, 3500 Cab Chassis, Ram 2500, and 4500 and 5500 Cab Chassis vehicles equipped with Cummins 6.7L turbo diesel engines. The engine control module (ECM) may have been built with a misaligned capacitor that can short-circuit, resulting in an internal loss of communication.

Remedy

Dealers will replace the ECM, free of charge. Owner notification letters are expected to be mailed October 15, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Z87.

Vehicles

MAKE MODEL YEAR

RAM 2500 2022

RAM 3500 2022

Front Passenger Air Bag May Not Deploy Properly

NHTSA Campaign Number: 22V652000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 4,117

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 Audi S3, A3, and RS3 vehicles. The front passenger air bag may have been folded incorrectly.

Remedy

Dealers will replace the front passenger air bag module, free of charge. Owner notification letters are expected to be mailed October 28, 2022. Owners may contact Audi's customer service at 1-800-253-2834. Audi's number for this recall is 69DZ.

Vehicles

MAKE MODEL YEAR

AUDI A3 2022

AUDI RS3 2022

Cloudy Camera Lens May Reduce Rear Visibility

NHTSA Campaign Number: 22V644000

Manufacturer Ford Motor Company

Components BACK OVER PREVENTION

Potential Number of Units Affected 277,040

Summary

Ford Motor Company (Ford) is recalling certain 2017-2020 F-Super Duty F-250, F-350, F-450, and 2017-2020 Lincoln Continental vehicles equipped with the 360-degree camera system. Degradation of the camera's anti-reflective lens coating can lead to a foggy or cloudy rearview camera image.

Remedy

Dealers will replace the rearview camera, free of charge. Owner notification letters are expected to be mailed September 12, 2022. Owners may contact Ford customer service at 1-800-1-866-436-7332. Ford's number for this recall is 22S51.

Vehicles

MAKE	MODEL	YEAR
FORD	F-250 SD	2017-2020
FORD	F-350 SD	2017-2020
FORD	F-450 SD	2017-2020
LINCOLN	CONTINENTAL	2017-2020

Electrical Short Circuit May Cause Engine Stall

NHTSA Campaign Number: 22V631000

Manufacturer PACCAR Incorporated

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 1,601

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2023 Peterbilt 220, 389, 520, 536, 537, 348, 367, 567, 548, 579, and 2023 Kenworth T680, K270, T440, T880, W990, K370, T280, T380, T480, T800, and W900 vehicles. The engine control module (ECM) may experience an internal electrical short-circuit, causing the engine to stall.

Remedy

Dealers will replace the ECM, free of charge. Owner notification letters are expected to be mailed October 16, 2022. Owners may contact Kenworth's customer service at 1-425-828-5888 and Peterbilt's customer service at 1-940-591-4220. PACCAR's number for this recall is 22KWG and 22PBG.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

KENWORTH	K270	2023
KENWORTH	K370	2023
KENWORTH	T280	2023
KENWORTH	T380	2023
KENWORTH	T440	2023
KENWORTH	T480	2023
KENWORTH	T680	2023
KENWORTH	T800	2023
KENWORTH	T880	2023
KENWORTH	W900	2023
KENWORTH	W990	2023
PETERBILT	220	2023
PETERBILT	348	2023
PETERBILT	367	2023
PETERBILT	389	2023
PETERBILT	520	2023
PETERBILT	536	2023
PETERBILT	537	2023
PETERBILT	548	2023
PETERBILT	567	2023
PETERBILT	579	2023