

NHTSA Recalls of Interest October 24, 2022

Front Seat Belt Pretensioners May Fail

NHTSA Campaign Number: 22V766000

Manufacturer Chrysler (FCA US, LLC)

Components SEAT BELTS

Potential Number of Units Affected 2,802

Summary

Chrysler (FCA US, LLC) is recalling certain 2022 Ram 1500, Jeep Gladiator, and 2021 Jeep Wrangler vehicles. The front seat belt retractors may have an improperly welded micro gas generator, which can result in seat belt pretensioner failure.

Remedy

Dealers will replace the front seat belt retractors. free of charge. Owner notification letters are expected to be mailed December 2, 2022. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is Z95.

Vehicles

MAKE MODEL YEAR

JEEP GLADIATOR 2022 JEEP WRANGLER 2021 RAM 1500 2022

Obstructed Rearview Camera Image/FMVSS 111

NHTSA Campaign Number: 22V747000

Manufacturer BMW of North America, LLC

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,296

Summary

BMW of North America, LLC (BMW) is recalling certain 2023 330e and 330e xDrive hybrid electric vehicles. After shifting into reverse, the rearview camera software may cause a portion of the rearview image to be obstructed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the rearview camera software, free of charge. Owner notification letters are expected to be mailed November 29, 2022. Owners may contact BMW customer service at 1-80-525-7417.

Vehicle

MAKE MODEL YEAR

BMW 330E 2023

Display May Freeze/FMVSS 101 & 102

NHTSA Campaign Number: 22V779000

Manufacturer PACCAR Incorporated

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 76,492

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2022-2023 Kenworth T680, T880, W990, and Peterbilt 365, 367, 389, 567, and 579 vehicles. The digital display may freeze and not display critical safety information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 101, "Control and Displays" and 102, "Trans Shift Lever Seq/Starter Interlock/Trans Braking Effect."

Remedy

Dealers will update the software, free of charge. Owner notification letters are expected to be mailed December 16, 2022. Owners may contact Kenworth's customer service at 1-425-828-5888 and Peterbilt's customer service at 1-940-591-4220. PACCAR's numbers for this recall are 22KWK and 22PBK.

Vehicles

MAKE MODEL YEAR

T680	2022-2023
T880	2022-2023
W990	2022-2023
365	2022-2023
367	2022-2023
389	2022-2023
567	2022-2023
579	2022-2023
	567

Delayed Rearview Camera Image/FMVSS 111

NHTSA Campaign Number: 22V764000

Manufacturer Volkswagen Group of America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 5

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 ID4 vehicles. The rearview camera image may be delayed or deactivated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the vehicle's software, free of charge. Owner notification letters are expected to be mailed December 9, 2022. Owners may contact Volkswagen's customer service at 1-800-893-5298. Volkswagen's number for this recall is 91EG.

Vehicle

MAKE MODEL YEAR

VOLKSWAGEN ID.4 2022

Rearview Display Inoperative/FMVSS 111

NHTSA Campaign Number: 22V772000

Manufacturer Nissan North America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 27,344

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2022 Titan, Titan XD, Frontier, and 2021-2022 Rogue vehicles. The in-vehicle infotainment (IVI) system may continuously reboot when the vehicle is restarted, which can result in an inoperative rearview display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

The IVI software will be updated by a dealer, or through an over-the-air (OTA) update, free of charge. Owner notification letters are expected to be mailed November 18, 2022. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's numbers for this recall are R22B8, R22C1, and PC923/25.

Vehicles

MAKE MODEL YEAR

NISSAN FRONTIER 2022 NISSAN ROGUE 2021-2022 NISSAN TITAN 2022 NISSAN TITAN XD 2022

Transmission Final Drive Gear Improperly Welded

NHTSA Campaign Number: 22V741000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 1

Summary

BMW of North America, LLC (BMW) is recalling one 2023 iX M60 hybrid electric vehicle. The transmission final drive gear in the electric drive unit may have an improperly manufactured weld seam.

Remedy

A dealer will replace the electric drive unit, free of charge. The owner notification letter is expected to be mailed November 28, 2022. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW IX 2023

High Voltage Battery Enclosure Not Properly Sealed

NHTSA Campaign Number: 22V771000

Manufacturer General Motors, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 824

Summary

General Motors, LLC (GM) is recalling certain 2022 BrightDrop EV600 and 2022-2023 GMC Hummer EV Pickup electric vehicles. The high voltage battery pack enclosure may not be properly sealed, allowing water to enter the pack.

Remedy

The remedy is currently under development. Interim letters notifying owners of the safety risk are expected to be mailed November 28, 2022. Second letters will be sent once the remedy is available. Owners may contact EV Concierge at 1-833-HUMMER-EV, and BrightDrop Service Operations and Support at 1-888-987-4377. GM's number for this recall is N222380031.

Vehicles

MAKE	MODEL	YEAR
BRIGHTDROP	EV600	2022
GMC	HUMMER EV	2022-2023