



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

October 31, 2022

[Inoperative Rearview Camera Display/FMVSS 111](#)

NHTSA Campaign Number: 22V804000

Manufacturer Lamborghini (Automobili Lamborghini)

Components BACK OVER PREVENTION

Potential Number of Units Affected 48

Summary

Lamborghini (Automobili Lamborghini) is recalling certain 2022 Urus vehicles. The infotainment system may become damaged, which can result in an inoperative rearview camera display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will replace the infotainment unit, free of charge. Owner notification letters are expected to be mailed December 16, 2022. Owners may contact Automobili Lamborghini customer service at 1-866-681-6276. Automobili Lamborghini's number for this recall is L636-R.01.22.

Vehicle

MAKE MODEL YEAR

LAMBORGHINI URUS 2022

HVAC Controls May Become Inoperative

NHTSA Campaign Number: 22V791000

Manufacturer Ford Motor Company

Components ELECTRICAL SYSTEM, VISIBILITY

Potential Number of Units Affected 31,339

Summary

Ford Motor Company (Ford) is recalling certain 2022-2023 Transit vehicles. The heating, ventilation, and air-conditioning (HVAC) system's controls, including those for defog and defrost, may become inoperative.

Remedy

Dealers will update the remote climate control module software, free of charge. Owner notification letters are expected to be mailed November 7, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S65.

Vehicle

MAKE MODEL YEAR

FORD TRANSIT 2022-2023

Loss of Drive Power

NHTSA Campaign Number: 22V793000

Manufacturer Volvo Car USA, LLC

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 15,674

Summary

Volvo Car USA, LLC (Volvo Car) is recalling certain 2022-2023 S60, V60, S90L, XC60, and XC90 vehicles. An electronic control module (ECM) software error may prevent the combustion engine from starting, causing a loss of drive power.

Remedy

Dealers will update the ECM software, free of charge. Owner notification letters are expected to be mailed December 8, 2022. Owners may contact Volvo Car's customer service at 1-800-458-1552. Volvo Car's number for this recall is R10198.

Vehicles

MAKE MODEL YEAR

VOLVO S60	2022-2023
VOLVO S90	2022-2023
VOLVO V60	2022-2023
VOLVO XC60	2022-2023
VOLVO XC90	2022-2023

Vehicle Rollaway from Guide Bushing Fatigue

NHTSA Campaign Number: 22V796000

Manufacturer Daimler Vans USA, LLC

Components POWER TRAIN

Potential Number of Units Affected 124,305

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2022 Mercedes-Benz Sprinter and Freightliner Sprinter vehicles equipped with a manual parking brake and 7-speed automatic transmission. The guide bushing on the parking pawl may fatigue, which can cause the parking pawl not to engage and result in vehicle rollaway.

Remedy

Dealers will update the software of various control units, including the electronic stability and transmission control units, free of charge. Owner notification letters are expected to be mailed December 19, 2022. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's numbers for this recall are 22V2790611, 22V2790612, and 22V2790613.

Vehicles

MAKE MODEL YEAR

FREIGHTLINER	SPRINTER 1500	2019-2022
FREIGHTLINER	SPRINTER 2500	2019-2022
FREIGHTLINER	SPRINTER 3500	2019-2022
FREIGHTLINER	SPRINTER 4500	2019-2022
MERCEDES-BENZ	SPRINTER 1500	2019-2022
MERCEDES-BENZ	SPRINTER 2500	2019-2022
MERCEDES-BENZ	SPRINTER 3500	2019-2022
MERCEDES-BENZ	SPRINTER 4500	2019-2022

Steering Column Pinch Bolt Improperly Secured

NHTSA Campaign Number: 22V797000

Manufacturer Autocar, LLC

Components STEERING

Potential Number of Units Affected 2,136

Summary

Autocar, LLC (Autocar) is recalling certain 2021-2023 Autocar Xpeditor vehicles. The steering column shaft pinch bolt may be improperly secured.

Remedy

Dealers will replace the steering column shaft pinch bolt, free of charge. Owner notification letters are expected to be mailed December 19, 2022. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACX-2206.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

AUTOCAR	XPEDITOR	2021-2023
---------	----------	-----------

Engine Compartment Fire

NHTSA Campaign Number: 22V800000

Manufacturer Kia America, Inc.

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 71,704

Summary

Kia America, Inc. (Kia) is recalling certain 2008-2009 Sportage vehicles previously recalled under recall 16V-815. An engine compartment fire originating from around the Hydraulic Electronic Control Unit (HECU) may occur while parked or driving.

Remedy

Owners are advised to park outside and away from structures and other vehicles until the recall repair has been performed. The remedy is currently under development. Owner notification letters are expected to be mailed

December 22, 2022. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC253.

Vehicle

MAKE MODEL YEAR

KIA SPORTAGE 2008-2009

Fuel Pump Control Module Bracket Not Secured

NHTSA Campaign Number: 22V787000

Manufacturer Ford Motor Company

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 26

Summary

Ford Motor Company (Ford) is recalling certain 2022 Bronco Sport vehicles. The fuel pump control module (FPCM) bracket may not be secured to the fuel tank assembly, which can lead to FPCM failure and cause an engine stall.

Remedy

Dealers will replace the fuel tank, free of charge. Owner notification letters are expected to be mailed December 5, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S66.

Vehicle

MAKE MODEL YEAR

FORD BRONCO SPORT 2022

Seat Belt Buckle, Anchor Incorrectly Reassembled

NHTSA Campaign Number: 22V798000

Manufacturer Tesla, Inc.

Components SEAT BELTS

Potential Number of Units Affected 24,064

Summary

Tesla, Inc. (Tesla) is recalling certain 2017-2022 Model 3 vehicles. The second-row left seat belt buckle and second-row center seat

belt anchor may have been incorrectly reassembled during vehicle service.

Remedy

Tesla Service will inspect and reassemble the seat belt anchors as necessary, free of charge. Owner notification letters are expected to

be mailed by December 20, 2022. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is

SB-22-20-004.

Vehicle

MAKE MODEL YEAR

TESLA MODEL 3 2017-2022