



# Automotive Safety Council

Prevent Protect Notify

## NHTSA Recalls of Interest

March 13, 2023

### Parking Sensor May Short Circuit and Cause Fire

An electrical short circuit increases the risk of a fire.

**NHTSA Campaign Number:** 23V132000

**Manufacturer** Hyundai Motor America

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 26,169

#### Summary

Hyundai Motor America (Hyundai) is recalling certain 2012-2013 Veloster vehicles. High conductive liquid may leak into the Reverse Park Aid Sensor (RPAS), which can result in an electrical short circuit.

#### Remedy

Dealers will replace the RPAS fuse and sensor, as necessary, free of charge. Owner notification letters are expected to be mailed April 29, 2023. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 242.

#### Vehicle

---

MAKE	MODEL	YEAR
HYUNDAI	VELOSTER	2012-201

---

## Parking Brake May Fail

Unexpected vehicle movement can increase the risk of a crash or injury.

**NHTSA Campaign Number:** 23V120000

**Manufacturer** Navistar, Inc.

**Components** ENGINE AND ENGINE COOLING

**Potential Number of Units Affected** 27,972

### Summary

Navistar, Inc. (Navistar) is recalling certain 2022-2024 International HV, International MV trucks, and 2022-2023 IC Bus TC commercial buses. When the parking brake is applied, the automatic transmission is still in drive or reverse position, and the stationary power take-off (PTO) switch is engaged by the operator, the engine may rev and overcome the parking brake's ability to keep the vehicle from moving.

### Remedy

Dealers will update the Cummins ECM software, free of charge. Owner notification letters are expected to be mailed April 24, 2023. Owners may contact Navistar's customer service at 1-800-448-7825. Navistar's number for this recall is 23504. This recall expands previous NHTSA recall number 20V-810.

### Vehicles

MAKE	MODEL	YEAR
IC BUS	TC	2022-2023
INTERNATIONAL	HV	2022-2024
INTERNATIONAL	MV	2022-2024

## Electric Park Brake May Fail and Cause Rollaway

A parking brake with weakened clamping performance can fail and allow the vehicle to rollaway, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V144000

**Manufacturer** Lordstown EV Corp

**Components** PARKING BRAKE

**Potential Number of Units Affected** 5

## Summary

Lordstown EV Corp (Lordstown) is recalling certain 2023 Endurance vehicles. The electric park brake (EPB) caliper washers may prematurely wear, decreasing the clamping performance of the EPB.

## Remedy

Dealers will replace the EPB, free of charge. Owner notification letters are expected to be mailed March 17, 2023. Owners may contact Lordstown customer service at 1-248-522-9100. Lordstown's number for this recall is R-0002.

## Vehicle

---

MAKE	MODEL	YEAR
LORDSTOWN	ENDURANCE	2023

---

## BCM Software May Cause Park Brake Failure

Park brake failure can allow the vehicle to move unexpectedly and increase the risk of a crash or injury.

**NHTSA Campaign Number:** 23V119000

**Manufacturer** Navistar, Inc.

**Components** ELECTRICAL SYSTEM, PARKING BRAKE

**Potential Number of Units Affected** 4,199

## Summary

Navistar, Inc. (Navistar) is recalling certain 2018-2021 International HV, 2019-2021 International RH, 2019-2022 International MV, and 2022 International HX vehicles. A software error in the Body Control Module (BCM) may cause the park brake to fail.

## Remedy

Dealers will update the BCM software, free of charge. Owner notification letters are expected to be mailed April 24, 2023. Owners may contact Navistar's customer service at 1-800-448-7825. Navistar's number for this recall is 23503.

## Vehicles

---

MAKE	MODEL	YEAR
INTERNATIONAL	HV	2018-2021

---

---

MAKE	MODEL	YEAR
INTERNATIONAL	HX	2022
INTERNATIONAL	MV	2019-2022
INTERNATIONAL	RH	2019-2021

---

## Side Curtain Air Bags May Not Deploy Properly

Air bags that do not deploy as intended can increase the risk of injury in a crash.

**NHTSA Campaign Number:** 23V149000

**Manufacturer** Kia America, Inc.

**Components** AIR BAGS

**Potential Number of Units Affected** 188,912

### Summary

Kia America, Inc. (Kia) is recalling certain 2021-2023 K5 vehicles. The side curtain air bags may have been installed incorrectly, causing them not to deploy properly in the event of a crash.

### Remedy

Dealers will inspect and reinstall the side curtain air bags, as necessary, free of charge. Owner notification letters are expected to be mailed April 7, 2023. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC263.

### Vehicle

---

MAKE	MODEL	YEAR
KIA	K5	2021-2023

---

## Passenger Air Bag May Impact Child Seat/FMVSS 208

Air bag impact with a child seat can increase the risk of injury to the occupant.

**NHTSA Campaign Number:** 23V136000

**Manufacturer** Ferrari North America, Inc.

**Components** SEATS

**Potential Number of Units Affected** 13

### Summary

Ferrari is recalling certain 2021-2023 Ferrari SF90 Coupe and 2022 SF90 Spider hybrid electric vehicles. When a child seat is installed on the passenger seat (size M), the deployment of the air bag may impact the child seat. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

### Remedy

Owners are advised not to use child seats in the vehicle until it is repaired. Dealers will replace the size M passenger seat with a size XL passenger seat, free of charge. Owner notification letters are expected to be mailed April 30, 2023. The manufacturer's number for this recall is RC 84.

### Vehicles

MAKE	MODEL	YEAR
FERRARI	SF90 SPIDER	2022
FERRARI	SF90 STRADALE	2021-2023

## Steering Wheel May Detach from Steering Column

A steering wheel with a loose or missing bolt can detach from the steering column, causing a loss of steering control, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V131000

**Manufacturer** Nissan North America, Inc.

**Components** STEERING

**Potential Number of Units Affected** 1,063

### Summary

Nissan North America, Inc. (Nissan) is recalling certain 2023 Ariya vehicles. The steering wheel bolt may have been tightened incorrectly or not installed.

### Remedy

Owners are advised to contact their dealer for transport and immediate repair if the steering wheel feels loose when gently rocking the wheel forward and back with their hands. Dealers will replace the steering wheel bolt, free of charge. Nissan began notifying owners on March 2, 2023 via phone and will follow up with owner notification letters beginning on March 30, 2023. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's number for this recall is PC956.

## Vehicle

---

MAKE	MODEL	YEAR
NISSAN	ARIYA	2023

---

## Third-Row Child Seat May Have Reduced Strength

A child seat with reduced strength may not properly restrain the occupant during a crash, increasing the risk of injury.

**NHTSA Campaign Number:** 23V137000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** CHILD SEAT, SEATS

**Potential Number of Units Affected** 812

### Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2023 Land Rover Defender 130 vehicles equipped with third-row seats. The third-row seatback latch may not latch properly, reducing the strength of a child seat installed to the top tether.

### Remedy

Dealers will inspect and replace the third-row seat frame and components, as necessary, free of charge. Owner notification letters are expected to be mailed April 28, 2023. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N768.

## Vehicle

---

MAKE	MODEL	YEAR
LAND ROVER	DEFENDER	2023

---

## Tonneau Cover May Detach

A tonneau cover that detaches while driving can become a road hazard, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V142000

**Manufacturer** Toyota Motor Engineering & Manufacturing

**Components** STRUCTURE

**Potential Number of Units Affected** 130,266

### Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2022-2023 Tundra and Tundra Hybrid vehicles that may be equipped with a Toyota genuine accessory tonneau cover. The tonneau cover attachment joints may come loose and allow the cover to detach.

### Remedy

Interim notification letters instructing owners to remove the tonneau cover if their vehicles are so equipped, are expected to be mailed March 31, 2023. The remedy is currently under development. Owners will receive a second notice once the remedy becomes available. Owners may contact Toyota's customer service at 1-800-331-4331. Toyota's number for this recall is 23TB03/23TA03.

### Vehicles

---

MAKE	MODEL	YEAR
TOYOTA	TUNDRA	2022-2023
TOYOTA	TUNDRA HYBRID	2022-2023

---