



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

Seat Belt Warning System Malfunction/FMVSS 208

A malfunctioning seat belt warning system may not alert the passenger to buckle their seat belt, increasing the risk of injury in the event of a crash.

NHTSA Campaign Number: 23V176000

Manufacturer Porsche Cars North America, Inc.

Components ELECTRICAL SYSTEM, SEAT BELTS

Potential Number of Units Affected 130

Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2020 Taycan Turbo, 2021 Taycan, Taycan 4S Cross Turismo, 2022 Taycan, Taycan Turbo, Taycan GTS, Taycan 4 Cross Turismo, Taycan 4S Cross Turismo, 2020-2022 Taycan 4S and Taycan Turbo S, and 2023 Taycan vehicles. When there is an unbelted passenger, the seat belt warning light and audible chime will not activate as intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will update the instrument cluster software, free of charge. Owner notification letters are expected to be mailed May 16, 2023. Owners may contact Porsche's customer service at 1-800-767-7243. Porsche's number for this recall is APA2.

Vehicles

MAKE	MODEL	YEAR
PORSCHE	TAYCAN	2021-2023

MAKE	MODEL	YEAR
PORSCHE	TAYCAN 4 CROSS TURISMO	2022
PORSCHE	TAYCAN 4S	2020-2022
PORSCHE	TAYCAN 4S CROSS TURISMO	2021-2022
PORSCHE	TAYCAN GTS	2022
PORSCHE	TAYCAN TURBO	2020, 2022
PORSCHE	TAYCAN TURBO CROSS TURISM	2022
PORSCHE	TAYCAN TURBO S	2020-2022

Insufficient Welds on Child Seat Tethers/FMVSS 225

A child that is not properly restrained during a crash can have an increased risk of injury.

NHTSA Campaign Number: 23V198000

Manufacturer Ford Motor Company

Components CHILD SEAT

Potential Number of Units Affected 19

Summary

Ford Motor Company (Ford) is recalling certain 2023 Edge and Lincoln Nautilus vehicles. The child seat tether wire welds on the second-row left-side seat back frame may be insufficient, which can reduce the seat's ability to properly restrain a child during a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 225, "Child Restraint Anchorage Systems."

Remedy

Dealers will replace the left-side second-row seat back frame, free of charge. Owner notification letters are expected to be mailed May 8, 2023. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 23C09.

Vehicles

MAKE	MODEL	YEAR
FORD	EDGE	2023
LINCOLN	NAUTILUS	2023

False Warning Message for Emergency Call System

The false warning message could prevent the detection of an actual e-call system failure, which could delay an emergency response during a crash, increasing the risk of injury.

NHTSA Campaign Number: 23V188000

Manufacturer Volvo Car USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 329

Summary

Volvo Car USA, LLC (Volvo Car) is recalling certain 2023 S60, V60CC, XC60, XC90, XC40, and C40 vehicles. A diagnostic trouble code (DTC) may be falsely detected for the emergency call system (e-call) and display "e-Call Service Required" in the driver information module (DIM).

Remedy

Dealers will update the telematics and connectivity antenna module (TCAM) software, free of charge. Owner notification letters are expected to be mailed May 16, 2023. Owners may contact Volvo Car's customer service 1-800-458-1552. Volvo Car's number for this recall is R10225.

Vehicles

MAKE	MODEL	YEAR
VOLVO	C40	2023
VOLVO	S60	2023
VOLVO	V60CC	2023

MAKE	MODEL	YEAR
VOLVO	XC40	2023
VOLVO	XC60	2023
VOLVO	XC90	2023

Instrument Panel May Fail to Display Information

A blank instrument panel will not show critical information, such as vehicle speed, fuel gauge, warning messages, and warning lights, increasing the risk of a crash.

NHTSA Campaign Number: 23V204000

Manufacturer Daimler Vans USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 6,857

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2022 Mercedes-Benz Sprinter and Freightliner Sprinter vehicles. The instrument cluster may fail to display any information when the vehicle is started.

Remedy

Dealers will update the instrument cluster software on the affected vehicles, free of charge. Owner notification letters are expected to be mailed May 1, 2023. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is 5496331.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 1500	2019-2022
FREIGHTLINER	SPRINTER 2500	2019-2022
FREIGHTLINER	SPRINTER 3500	2019-2022

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 4500	2019-2022
MERCEDES-BENZ	SPRINTER 1500	2019-2022
MERCEDES-BENZ	SPRINTER 2500	2019-2022
MERCEDES-BENZ	SPRINTER 3500	2019-2022
MERCEDES-BENZ	SPRINTER 4500	2019-2022

Parking Brake Valve Module May Cause Rollaway

A parking brake that is not engaged as expected when the driver releases the brakes may allow the vehicle to rollaway, increasing the risk of crash.

NHTSA Campaign Number: 23V205000

Manufacturer Tesla, Inc.

Components PARKING BRAKE

Potential Number of Units Affected 35

Summary

Tesla, Inc. (Tesla) is recalling certain 2023 Semi trucks. The electronic parking brake valve module (PVM) may fail to move into the park position when the parking brake is activated.

Remedy

Tesla service will replace the PVM, free of charge. Owner notification letters are expected to be mailed May 23, 2023. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-23-33-001.

Vehicle

MAKE	MODEL	YEAR
TESLA	SEMI	2023

Disabled Safety Features from Water Intrusion

Disabled safety features, including seat belt tightening and seat adjustments, can increase the risk of injury in a crash.

NHTSA Campaign Number: 23V200000

Manufacturer Mercedes-Benz USA, LLC

Components STRUCTURE, ELECTRICAL SYSTEM

Potential Number of Units Affected 6

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2021 Maybach S580 and S580 vehicles. The bulkhead that separates the engine compartment from the passenger compartment may not have been properly sealed, causing water to drain into the passenger compartment. Water intrusion into the foot wells may cause corrosion and/or short circuits to electrical components, disabling safety features, including seat belt tightening and seat adjustments (PreSafe system).

Remedy

Dealers will repair the bulkhead front wall sealing, free of charge. Owner notification letters are expected to be mailed May 23, 2023. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	MAYBACH S580	2021
MERCEDES-BENZ	S580	2021

Air Bag May Tear

In the event of a crash, a torn air bag cannot protect occupants as intended, increasing the risk of injury.

NHTSA Campaign Number: 23V189000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 5,224

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 2022-2023 Q4 E-Tron SUV and Q4 E-Tron Sportback vehicles. During deployment, the head curtain air bag could deform the door seal and expose the metal inlay within the seal, which could tear the air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 226, "Ejection Mitigation."

Remedy

Dealers will install cloth tape in the driver and front passenger B-pillar area, free of charge. Owner notification letters are expected to be mailed May 19, 2023. Owners may contact Audi's customer service at 1-800-253-2834. Audi's number for this recall is 69FA.

Vehicle

MAKE	MODEL	YEAR
AUDI	Q4 E-TRON	2022-2023
