



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

May 15, 2023

### Driver's Air Bag Inflator May Explode

An inflator explosion may result in sharp metal fragments striking the driver or other occupants, resulting in serious injury or death.

**NHTSA Campaign Number:** 23V334000

**Manufacturer** General Motors, LLC

**Components** AIR BAGS

**Potential Number of Units Affected** 994,763

#### Summary

General Motors, LLC (GM) is recalling certain 2014-2017 Buick Enclave, Chevrolet Traverse, and GMC Acadia vehicles. The driver's air bag inflator may explode during deployment, due to a manufacturing defect.

#### Remedy

Dealers will replace the driver's air bag module, free of charge. Owner notification letters are expected to be mailed June 26, 2023. Owners may contact Buick customer service at 1-800-521-7300, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is N232404980.

#### Vehicles

---

MAKE	MODEL	YEAR
BUICK	ENCLAVE	2014-2017

---

---

MAKE	MODEL	YEAR
CHEVROLET	TRAVERSE	2014-2017
GMC	ACADIA	2014-2017

---

## Vehicle Doors May Open Unexpectedly

**NHTSA Campaign Number:** 23V312000

**Manufacturer** Volkswagen Group of America, Inc.

**Components** STRUCTURE

**Potential Number of Units Affected** 35,325

### Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021-2022 ID.4 vehicles. The affected vehicles may have been manufactured with door handles that allow water to enter the circuit board assembly, which can cause the doors to open unexpectedly when the vehicle is subject to high lateral forces at speeds below 9 mph/15 kmh.

### Remedy

Dealers will update the vehicle software, and inspect the door handles as necessary, free of charge. Owner notification letters are expected to be mailed June 30, 2023. Owners may contact Volkswagen's customer service at 1-800-893-5298. Volkswagen's number for this recall is 57J5.

### Vehicle

---

MAKE	MODEL	YEAR
VOLKSWAGEN	ID.4	2021-2022

---

## Rearview Image May Not Display/FMVSS 111

A rearview camera that does not display an image can reduce the driver's rear view, increasing the risk of a crash or injury.

**NHTSA Campaign Number:** 23V305000

**Manufacturer** Ford Motor Company

## Components BACK OVER PREVENTION

**Potential Number of Units Affected** 521

### Summary

Ford Motor Company (Ford) is recalling certain 2020-2022 Explorer Police Interceptor Utility vehicles equipped with a 12.1-inch Integrated Computer Screen (ICS). When the Display On/Off Button is used to turn the display to "Off" prior to placing the vehicle in reverse, the backup camera rearview image will not appear on the display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

### Remedy

Dealers will update the ICS software, free of charge. Owner notification letters are expected to be mailed May 29, 2023. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 23C14.

### Vehicle

---

MAKE	MODEL	YEAR
FORD	EXPLORER	2020-2022

---

## Storage Compartment Latch Failure/FMVSS 201

In the event of a crash, unsecured objects from within the armrest compartment may strike the vehicle occupants, increasing their risk of injury.

**NHTSA Campaign Number:** 23V324000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** LATCHES/LOCKS/LINKAGES

**Potential Number of Units Affected** 12,587

### Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2022-2023 Land Rover Range Rover and 2023 Land Rover Range Rover Sport vehicles. The second-row seat armrest storage compartment latch may fail, allowing the objects from within to be unsecured in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 201, "Occupant Protection in Interior Impact."

### Remedy

Dealers will replace the locking arm of the second-row armrest storage compartment, free of charge. Owner notification letters are expected to be mailed June 30, 2023. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N789.

### Vehicles

---

MAKE	MODEL	YEAR
LAND ROVER	RANGE ROVER	2022-2023
LAND ROVER	RANGE ROVER SPORT	2023

---

## Driveshaft May Separate

A sudden loss of drive power can increase the risk of a crash.

**NHTSA Campaign Number:** 23V322000

**Manufacturer** Navistar, Inc.

**Components** POWER TRAIN

**Potential Number of Units Affected** 49

### Summary

Navistar, Inc. (Navistar) is recalling certain 2023 International MV trucks. The driveshaft tube seam weld may separate or tear, resulting in drive line separation and a sudden loss of drive power.

### Remedy

Dealers will replace the driveshafts, free of charge. Owner notification letters are expected to be mailed July 3, 2023. Owners may contact Navistar's customer service at 1-800-448-7825. Navistar's number for this recall is 23513.

### Vehicle

---

MAKE	MODEL	YEAR
INTERNATIONAL	MV	2023

---

## HV Battery Cell Monitoring Circuit Not Secured

An engine stall increases the risk of a crash.

**NHTSA Campaign Number:** 23V295000

**Manufacturer** BMW of North America, LLC

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 31

**Summary**

BMW of North America, LLC (BMW) is recalling certain 2022-2024 iX xDrive50 and 2023 i4 eDrive35, i4 eDrive40, and i4 M50 Hybrid Electric vehicles. The high voltage battery cell monitoring circuit may have improperly secured electrical connections which can result in an engine stall.

**Remedy**

Dealers will replace the high voltage battery cell monitoring circuit, free of charge. Owner notification letters are expected to be mailed June 16, 2023. Owners may contact BMW customer service at 1-800-525-7417.

**Vehicles**

---

MAKE	MODEL	YEAR
BMW	I4	2023
BMW	IX	2022-2024

---