



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

July 10, 2023

Loose Fastener on Brake Booster Assembly

Brake master cylinder separation can cause a loss of brake function and increase the risk of a crash.

NHTSA Campaign Number: 23V458000

Manufacturer Honda (American Honda Motor Co.)

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 124,077

Summary

Honda (American Honda Motor Co.) is recalling certain 2020-2021 Civic, 2020-2023 Ridgeline, 2021-2023 Passport, 2021-2022 Pilot, and 2020 Acura MDX vehicles. The tie rod fastener that connects the brake booster and the brake master cylinder may have been improperly assembled during manufacturing, which can cause the brake master cylinder to separate from the booster assembly.

Remedy

Dealers will inspect and repair the brake booster assembly as necessary, free of charge. Owner notification letters are expected to be mailed August 7, 2023. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are VEU, AEV, and ZET.

Vehicles

MAKE	MODEL	YEAR
ACURA	MDX	2020

MAKE	MODEL	YEAR
HONDA	CIVIC	2020-2021
HONDA	PASSPORT	2021-2023
HONDA	PILOT	2021-2022
HONDA	RIDGELINE	2020-2023

Loss of Drive Power

A loss of drive power can increase the risk of a crash.

NHTSA Campaign Number: 23V462000

Manufacturer Mercedes-Benz USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 8,178

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022-2023 C300 and 2023 AMG C43 vehicles. The transmission wiring harness may be the incorrect length, which can result in harness damage and a loss of drive power.

Remedy

Dealers will inspect and repair the transmission wiring harness routing, as necessary, free of charge. Owner notification letters are expected to be mailed August 29, 2023. Owners may contact MBUSA customer service at 1-800-367-6373.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG C43	2023
MERCEDES-BENZ	C300	2022-2023

Improperly Secured Electrical Wiring Harness

An overheated wiring harness can increase the risk of a fire.

NHTSA Campaign Number: 23V463000

Manufacturer Mercedes-Benz USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 1,552

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022-2023 C300 and 2023 AMG C43 vehicles. The ground connections for the electrical wiring harness may not be secured properly, which can result in the electrical wiring harness overheating.

Remedy

Dealers will inspect and repair the ground connections for the electrical wiring harness, as necessary, free of charge. Owner notification letters are expected to be mailed August 29, 2023. Owners may contact MBUSA customer service at 1-800-367-6373.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG C43	2023
MERCEDES-BENZ	C300	2022-2023

Unsecured Rear Seat Belt Buckles

Unsecured seat belts may not properly restrain occupants in the event of a crash, increasing the risk of an injury.

NHTSA Campaign Number: 23V464000

Manufacturer Mercedes-Benz USA, LLC

Components SEAT BELTS

Potential Number of Units Affected 6

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022-2023 EQS450 and 2022 EQS580 vehicles. The bolts that secure the rear seat belt buckles to the body of the vehicle may not be secured properly.

Remedy

Dealers will inspect and secure the rear seat belt buckle bolts, as necessary, free of charge. Owner notification letters are expected to be mailed August 29, 2023. Owners may contact MBUSA customer service at 1-800-367-6373.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	EQS450	2022-2023
MERCEDES-BENZ	EQS580	2022

Rearview Camera Image May Not Display/FMVSS 111

The loss of the rearview camera image while in reverse can reduce the driver's rear visibility, increasing the risk of a crash.

NHTSA Campaign Number: 23V466000

Manufacturer Polaris Industries Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 22,218

Summary

Polaris Industries Inc. (Polaris) is recalling certain 2020 Slingshot GT, 2021-2023 Slingshot S, Slingshot S Tech, 2020-2023 Slingshot R, Slingshot SL, and 2022-2023 Slingshot SLR vehicles updated with Ride Command Software, version SLS7AB.M32304A. After shifting out of reverse, the rearview camera image may freeze and display a blank screen if shifted into reverse again. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed July 28, 2023. Owners may contact Polaris' customer service at 1-855-863-2284. Polaris' number for this recall is T-23-03.

Vehicles

MAKE	MODEL	YEAR
POLARIS	SLINGSHOT GT	2020

MAKE	MODEL	YEAR
POLARIS	SLINGSHOT R	2020-2023
POLARIS	SLINGSHOT S	2021-2023
POLARIS	SLINGSHOT S TECH	2021-2023
POLARIS	SLINGSHOT SL	2020-2023
POLARIS	SLINGSHOT SLR	2022-2023
