



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

June 26, 2023

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera with a delayed or deactivated image may reduce the driver's rear visibility, increasing the risk of a crash.

NHTSA Campaign Number: 23V436000

Manufacturer Volkswagen Group of America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 4

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2022 ID.4 vehicles. The replacement infotainment central control unit (CCU) installed in the vehicle during a repair contains incorrect software that can cause the rearview camera image to be delayed or deactivated when reversing. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the software, free of charge. Owner notification letters are expected to be mailed August 18, 2023. Owners may contact Volkswagen's customer service at 1-800-893-5298. Volkswagen's number for this recall is 93S7.

Vehicle

MAKE	MODEL	YEAR
VOLKSWAGEN	ID.4	2022

Rearview Image May Not Display/FMVSS 111

A rearview camera that does not display an image can reduce the driver's rear view, increasing the risk of a crash or injury.

NHTSA Campaign Number: 23V431000

Manufacturer Honda (American Honda Motor Co.)

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,198,280

Summary

Honda (American Honda Motor Co.) is recalling certain 2018-2023 Odyssey, 2019-2022 Pilot, and 2019-2023 Passport vehicles. Due to a faulty Media Oriented Systems Transport (MOST) communication coaxial cable connector, the rearview camera image may not appear on the display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will replace the MOST cable harness and install a straightening cover over the vehicle cable connector, free of charge. Owner notification letters are expected to be mailed July 24, 2023. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are EEL and ZEM.

Vehicles

MAKE	MODEL	YEAR
HONDA	ODYSSEY	2018-2023
HONDA	PASSPORT	2019-2023
HONDA	PILOT	2019-2022

Defective Pyrotechnic Battery Disconnect

A defective battery disconnect may not isolate the vehicle's high voltage battery after a crash or fault detection, increasing the risk of electrical shock and injury.

NHTSA Campaign Number: 23V434000

Manufacturer Tesla, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 26

Summary

Tesla, Inc. (Tesla) is recalling certain 2023 Model 3 and Model Y vehicles. The pyrotechnic battery disconnect may be defective.

Remedy

Tesla Service will replace the pyrotechnic battery disconnect, free of charge. Owner notification letters are expected to be mailed August 15, 2023. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-23-16-005.

Vehicles

MAKE	MODEL	YEAR
TESLA	MODEL 3	2023
TESLA	MODEL Y	2023

Unintended Vehicle Movement from Brake Fluid Leak

Unintended vehicle movement or an unexpected increase in brake pedal travel can increase the risk of a crash or injury.

NHTSA Campaign Number: 23V430000

Manufacturer Honda (American Honda Motor Co.)

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 386

Summary

Honda (America Honda Motor Co.) is recalling certain 2023 Civic, Acura RDX, Acura Integra, and 2022 Honda Accord vehicles. A ball valve in the vehicle stability assist (VSA) modulator may leak brake fluid, which can result in unintended vehicle movement when the brake hold feature is engaged or an unexpected increase in brake pedal travel.

Remedy

Dealers will replace the VSA modulator, free of charge. Owner notification letters are expected to be mailed July 24, 2023. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are GEI, DEG, XEK, and OEJ.

Vehicles

MAKE	MODEL	YEAR
ACURA	INTEGRA	2023
ACURA	RDX	2023
HONDA	ACCORD	2022
HONDA	CIVIC	2023

Deformation of the Strut Mount

Loose suspension connections can cause steering instability, increasing the risk of a crash.

NHTSA Campaign Number: 23V437000

Manufacturer Volkswagen Group of America, Inc.

Components SUSPENSION

Potential Number of Units Affected 59

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2023 Golf R A8 and Golf GTI vehicles. The strut mount may be deformed, loosening the bolted connections to the suspension strut mounting.

Remedy

Dealers will inspect and replace the right and/or left suspension strut mountings, as necessary, free of charge. Owner notification letters are expected to be mailed August 18, 2023. Owners may contact Volkswagen's customer service at 1-800-893-5298. Volkswagen's number for this recall is 40T3.

Vehicles

MAKE	MODEL	YEAR
VOLKSWAGEN	GOLF R	2023
VOLKSWAGEN	GTI	2023

Loss of Vehicle Control

A loss of vehicle control increases the risk of a crash.

NHTSA Campaign Number: 23V429000

Manufacturer Mazda North American Operations

Components STEERING, SUSPENSION

Potential Number of Units Affected 18

Summary

Mazda North American Operations (Mazda) is recalling certain 2024 CX-90 vehicles. Some steering and suspension bolts may be missing or improperly tightened, which can cause the steering intermediate shaft, the front anti-lock brake system wheel speed sensor harnesses, or the front upper control arms to detach, resulting in a loss of vehicle control.

Remedy

Dealers will inspect and tighten or replace the steering and suspension bolts, as necessary, free of charge. Owner notification letters are expected to be mailed July 14, 2023. Owners may contact Mazda customer service at 1-800-222-5500 Option 6. Mazda's number for this recall is 5923F.

Vehicle

MAKE	MODEL	YEAR
MAZDA	CX-90	2024
