



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

August 14, 2023

B-Pillar Trim May Interfere with Air Bag/FMVSS 226

A compromised deployment of the SABIC can reduce occupant protection in the event of a crash, increasing the risk of injury.

NHTSA Campaign Number: 23V545000

Manufacturer Chrysler (FCA US, LLC)

Components STRUCTURE

Potential Number of Units Affected 44,708

Summary

Chrysler (FCA US, LLC) is recalling certain 2022-2023 Jeep Wagoneer and Grand Wagoneer vehicles. The upper B-pillar interior trim may not be fully seated and could interfere with the side curtain air bag (SABIC) deployment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 226, "Ejection Mitigation."

Remedy

Dealers will inspect and reseal or replace the trim pieces as necessary, free of charge. Owner notification letters are expected to be mailed September 22, 2023. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 76A.

Vehicles

| MAKE | MODEL | YEAR |
|------|----------------|-----------|
| JEEP | GRAND WAGONEER | 2022-2023 |

| MAKE | MODEL | YEAR |
|------|----------|-----------|
| JEEP | WAGONEER | 2022-2023 |

Front Passenger Seat Belt May Fail/FMVSS 208 & 209

A seat belt that fails to fasten or extend properly may not adequately restrain an occupant in a crash, increasing the risk of injury.

NHTSA Campaign Number: 23V557000

Manufacturer Hyundai Motor America

Components SEAT BELTS

Potential Number of Units Affected 168

Summary

Hyundai Motor America (Hyundai) is recalling certain 2023 Genesis GV60 vehicles. The automatic locking retractor for the front passenger-side seat belt may prohibit the seat belt from fastening and/or extending properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 208, "Occupant Crash Protection" and 209, "Seat Belt Assemblies."

Remedy

Dealers will inspect and replace the front passenger-side seat belt, as necessary, free of charge. Owner notification letters are expected to be mailed October 3, 2023. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 015G.

Vehicle

| MAKE | MODEL | YEAR |
|---------|-------|------|
| GENESIS | GV60 | 2023 |

Inaccurate Pedestrian Warning Sounds/FMVSS 141

Inaccurate external warning sounds may confuse pedestrians about the direction of an approaching vehicle, increasing the risk of a crash or injury.

NHTSA Campaign Number: 23V553000

Manufacturer Mazda North American Operations

Components FORWARD COLLISION AVOIDANCE, BACK OVER PREVENTION

Potential Number of Units Affected 17,600

Summary

Mazda North American Operations (Mazda) is recalling certain 2024 CX-90 vehicles. Software in the Approaching Vehicle Audible System (AVAS) Information Sound Box (ISB) amplifier may be missing, which can cause inaccurate, external pedestrian warning sounds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 141, "Minimum Sound Requirements for Hybrid Electric Vehicles."

Remedy

Dealers will update the AVAS ISB amplifier software, free of charge. Owner notification letters are expected to be mailed October 3, 2023. Owners may contact Mazda customer service at 1-800-222-5500 Option 6. Mazda's number for this recall is 6123H.

Vehicle

| MAKE | MODEL | YEAR |
|-------|-------|------|
| MAZDA | CX-90 | 2024 |

Driveshaft May Break

A broken driveshaft can separate and cause a loss of drive power, increasing the risk of a crash.

NHTSA Campaign Number: 23V538000

Manufacturer Daimler Trucks North America, LLC

Components POWER TRAIN

Potential Number of Units Affected 614

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2023-2024 Thomas Built Bus SAF-T-Liner C2 school buses. The driveshafts can break under certain loading conditions.

Remedy

Dealers will replace the driveshafts, free of charge. Owner notification letters are expected to be mailed September 30, 2023. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL980.

Vehicle

| MAKE | MODEL | YEAR |
|--------------------|----------------|-----------|
| THOMAS BUILT BUSES | SAF-T-LINER C2 | 2023-2024 |

Driveshaft May Break

A broken driveshaft can separate and cause a loss of drive power, increasing the risk of a crash.

NHTSA Campaign Number: 23V537000

Manufacturer Daimler Trucks North America, LLC

Components POWER TRAIN

Potential Number of Units Affected 1,280

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2023 Freightliner M2, FCCC MT 55G Walk in Van Chassis, FCCC S2C-106 Conventional Cab & Chassis, FCCC MC Chassis, and Thomas Built SAF-T-LINER C2 vehicles. The driveshafts can break under certain loading conditions.

Remedy

Dealers will replace the driveshafts, free of charge. Owner notification letters are expected to be mailed September 30, 2023. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL980.

Vehicles

| MAKE | MODEL | YEAR |
|--------------------|----------------|------|
| FCCC | MC | 2023 |
| FCCC | MT55G | 2023 |
| FCCC | S2C 106 | 2023 |
| FREIGHTLINER | M2 | 2023 |
| THOMAS BUILT BUSES | SAF-T-LINER C2 | 2023 |

High Voltage Battery May Overheat

A high voltage battery that sparks and overheats increases the risk of a fire.

NHTSA Campaign Number: 23V568000

Manufacturer Jaguar Land Rover North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 1

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling one 2023 Land Rover Range Rover PHEV vehicle. A bolt for the high voltage battery may not be secured properly, which can result in the high voltage battery sparking and overheating.

Remedy

A dealer will replace the high voltage battery, free of charge. An owner notification letter is expected to be mailed October 6, 2023. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N786.

Vehicle

| MAKE | MODEL | YEAR |
|------------|------------------|------|
| LAND ROVER | RANGE ROVER PHEV | 2023 |

Headlights May Fail/FMVSS 108

Headlight failure or incorrectly adjusted headlights can reduce visibility and increasing the risk of a crash.

NHTSA Campaign Number: 23V541000

Manufacturer Hino Motors Sales U.S.A., Inc.

Components EXTERIOR LIGHTING

Potential Number of Units Affected 468

Summary

Hino Motors Sales U.S.A., Inc. (Hino) is recalling certain 2022-2023 NE7A, NJ7A, NJ7B and NV7A vehicles, equipped with headlights that are recessed in the hood. The headlight back covers, and anti-adjustment caps may have been improperly installed, which can result in headlight failure, or the headlights being adjusted incorrectly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will inspect the anti-adjustment caps and back covers. In addition, dealers will confirm the headlight aim, and install any missing caps or covers. All repairs will be performed free of charge. Owner notification letters are expected to be mailed October 3, 2023. Owners may contact Hino customer service at 1-248-699-9390. Hino's number for this recall is M0430.

Vehicles

MAKE

MODEL

YEAR

HINO

NE7A

2022-2023

HINO

NJ7A

2022-2023

HINO

NJ7B

2022-2023

HINO

NV7A

2022-2023
