



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

August 21, 2023

### Front Passenger Air Bag May Deploy Improperly

An air bag that does not deploy properly in a crash increases the risk of injury.

**NHTSA Campaign Number:** 23V567000

**Manufacturer** General Motors, LLC

**Components** AIR BAGS, ELECTRICAL SYSTEM

**Potential Number of Units Affected** 317

#### Summary

General Motors, LLC (GM) is recalling certain 2022-2023 Chevrolet Bolt EV vehicles. The instrument panel may be missing the perforation on the underside of the panel cover that allows the passenger-side air bag to deploy properly.

#### Remedy

Dealers will replace the instrument panel, free of charge. Owner notification letters are expected to be mailed September 25, 2023. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N232414710.

#### Vehicle

---

MAKE	MODEL	YEAR
CHEVROLET	BOLT EV	2022-2023

---

## Tie Rod May Bend

A bent tie rod can break and cause a loss of steering control, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V581000

**Manufacturer** Nissan North America, Inc.

**Components** STEERING

**Potential Number of Units Affected** 236,238

### Summary

Nissan North America, Inc. (Nissan) is recalling certain 2020-2022 Sentra vehicles. The left and/or right tie rod may bend.

### Remedy

Owners are advised to contact their dealer for transport assistance if they are experiencing an off-center steering wheel or vibration. As an interim repair, dealers will inspect and replace any bent or broken tie rods, free of charge. Once newly designed parts are available, dealers will replace both left and right tie rods, free of charge. Interim letters are expected to be mailed October 5, 2023. A second letter will be mailed once the final remedy is available. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's number for this recall is R23B3. This recall replaces and expands recall number 21V-461. Vehicles previously repaired under 21V-461 will need to have the new remedy completed.

### Vehicle

---

MAKE	MODEL	YEAR
NISSAN	SENTRA	2020-2022

---

## Loss of Engine Power from Electrical Corrosion

Corrosion of the ignition coil pack fuses can cause a misfire and loss of engine power, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V564000

**Manufacturer** Isuzu Motors Limited

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 19,479

### Summary

Isuzu Motors Limited (Isuzu) is recalling certain 2023-2024 NPR Gas, NPR HD Gas, 2024 NQR Gas, NRR Gas, 2023-2024 Chevrolet LCF 3500HG, Chevrolet LCF 4500HG, 2024 Chevrolet LCF 5500HG, and Chevrolet LCF 5500XG vehicles. The chassis harness may have an incorrectly sized wire seal for the 2 externally mounted engine ignition coil pack fuse holders, which can allow water intrusion and cause the fuses to corrode.

## Remedy

Dealers will replace both engine ignition coil pack fuse holder assemblies, free of charge. Owner notification letters are expected to be mailed September 29, 2023. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V2305.

## Vehicles

MAKE	MODEL	YEAR
ISUZU	CHEVROLET LCF 3500HG	2023-2024
ISUZU	CHEVROLET LCF 4500HG	2023-2024
ISUZU	CHEVROLET LCF 5500HG	2024
ISUZU	CHEVROLET LCF 5500XG	2024
ISUZU	N-SERIES	2023-2024

## Incorrect Rearview Camera Image May Display

An incorrect rearview camera image can reduce the driver's view of what is behind the vehicle, increasing the risk of a crash or injury.

**NHTSA Campaign Number:** 23V573000

**Manufacturer** Ford Motor Company

**Components** BACK OVER PREVENTION

**Potential Number of Units Affected** 18,513

### Summary

Ford Motor Company (Ford) is recalling certain 2023 F-Super Duty F250, F350, and F450 vehicles equipped with the Pro Trailer Hitch Assist feature. The default rearview camera image may not be displayed when using the Pro Trailer Hitch Assist feature.

### Remedy

Dealers will update the Advanced Drive Assistance System (ADAS) module software, free of charge. Owner notification letters are expected to be mailed September 18, 2023. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 23S46.

## Vehicles

MAKE	MODEL	YEAR
FORD	F-250 SD	2023
FORD	F-350 SD	2023
FORD	F-450 SD	2023

## Rearview Camera Image May Not Display/FMVSS 111

A rearview image that does not display while in reverse decreases the driver's visibility of the rear view, increasing the risk of injury or crash.

**NHTSA Campaign Number:** 23V577000

**Manufacturer** Chrysler (FCA US, LLC)

**Components** BACK OVER PREVENTION

**Potential Number of Units Affected** 162,713

### Summary

Chrysler (FCA US, LLC) is recalling certain 2022-2023 Jeep Grand Cherokee, 2021-2023 Jeep Grand Cherokee L, and 2022-2024 Jeep Wagoneer and Grand Wagoneer vehicles. The Central Vision Park Assist module (CVPAM) software may prevent the rearview image from displaying when the vehicle is placed in reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

### Remedy

Dealers will update the Central Vision Park Assist Module software, free of charge. Owner notification letters are expected to be mailed October 3, 2023. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 56A.

## Vehicles

MAKE	MODEL	YEAR
JEEP	GRAND CHEROKEE	2021-2023

MAKE	MODEL	YEAR
JEEP	GRAND WAGONEER	2022-2024
JEEP	WAGONEER	2022-2024

## Software Error in Exit Warning System

Failure to alert occupants of an approaching vehicle can increase the risk of a crash or injury.

**NHTSA Campaign Number:** 23V574000

**Manufacturer** Mercedes-Benz USA, LLC

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 880

### Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2023 E450, E350, AMG E63 S, AMG E53, CLS450, AMG GT53, and AMG GT43 vehicles. Due to a software error, the exit warning system audio and visual warnings may fail to alert occupants about approaching vehicles.

### Remedy

Dealers will update the exit warning system software, free of charge. Owner notification letters are expected to be mailed October 10, 2023. Owners may contact MBUSA customer service at 1-800-367-6372.

### Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG E53	2023
MERCEDES-BENZ	AMG E63 S	2023
MERCEDES-BENZ	AMG GT43	2023
MERCEDES-BENZ	AMG GT53	2023

---

MAKE	MODEL	YEAR
MERCEDES-BENZ	CLS450	2023
MERCEDES-BENZ	E350	2023
MERCEDES-BENZ	E450	2023

---