



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

November 6, 2023

### Pop-Up Hood May Not Activate in Pedestrian Crash

A pop-up engine hood that does not activate and raise the rear end of the hood in a frontal pedestrian crash, can increase the risk of injury.

**NHTSA Campaign Number:** 23V725000

**Manufacturer** Nissan North America, Inc.

**Components** STRUCTURE

**Potential Number of Units Affected** 988

#### Summary

Nissan North America, Inc. (Nissan) is recalling certain 2023-2024 Nissan Z vehicles. The fasteners in the left-side front bumper reinforcement clip may loosen, which can prevent the pop-up engine hood from activating.

#### Remedy

Dealers will tighten the fasteners, free of charge. Owner notification letters are expected to be mailed December 7, 2023. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's number for this recall is R23C8.

#### Vehicle

---

MAKE	MODEL	YEAR
NISSAN	Z	2023-2024

---

# Seat-Mounted Air Bag May Deploy Unnecessarily

Air bags that deploy unnecessarily can increase the risk of injury.

**NHTSA Campaign Number:** 23V715000

**Manufacturer** Porsche Cars North America, Inc.

**Components** AIR BAGS

**Potential Number of Units Affected** 2,923

## Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2021-2023 911 Turbo S, 2022 911 Turbo, 2022-2023 911 GT3 Touring, 911 GT3, 911 Carrera 4 GTS, 2022-2024 911 Carrera GTS, 2023 911 GT3 RS, 911 Dakar, and 2024 911 Carrera T vehicles equipped with optional full bucket seats. The seat-mounted air bags may deploy unnecessarily during a crash.

## Remedy

Dealers will reprogram the air bag control unit, free of charge. Owner notification letters are expected to be mailed December 22, 2023. Owners may contact Porsche's customer service at 1-800-767-7243. Porsche's number for this recall is APB3.

## Vehicles

MAKE	MODEL	YEAR
PORSCHE	911 CARRERA 4 GTS	2022-2023
PORSCHE	911 CARRERA GTS	2022-2024
PORSCHE	911 CARRERA T	2024
PORSCHE	911 DAKAR	2023
PORSCHE	911 GT3	2022-2023
PORSCHE	911 GT3 RS	2023

---

MAKE	MODEL	YEAR
PORSCHE	911 GT3 TOURING	2022-2023
PORSCHE	911 TURBO	2022
PORSCHE	911 TURBO S	2021-2023

---

### Seat Belt May Fail

An unsecured seat belt connection may not properly restrain an occupant during a crash, increasing their risk of injury.

**NHTSA Campaign Number:** 23V717000

**Manufacturer** PACCAR Incorporated

**Components** SEAT BELTS

**Potential Number of Units Affected** 3,841

#### Summary

PACCAR Incorporated (PACCAR) is recalling certain 2020 Kenworth T660, 2018-2024 Kenworth T800 and W900 vehicles. An additional spacer may have been added to the joint that connects the seat to the seat belt tether and buckle, causing an unsecured connection.

#### Remedy

Dealers will inspect and remove the additional spacer and replace the bolt, as necessary, free of charge. Owner notification letters are expected to be mailed December 25, 2023. Owners may contact PACCAR's customer service at 1-425-828-5888. PACCAR's number for this recall is 23KWK.

#### Vehicles

---

MAKE	MODEL	YEAR
KENWORTH	T660	2020
KENWORTH	T800	2018-2024

---

---

MAKE	MODEL	YEAR
KENWORTH	W900	2018-2024

---

## Seat Belt Assembly Inaccessible/FMVSS 208 & 209

An unfastened seat belt may increase the risk of injury to occupants during a crash.

**NHTSA Campaign Number:** 23V716000

**Manufacturer** Chrysler (FCA US, LLC)

**Components** SEAT BELTS

**Potential Number of Units Affected** 97,066

### Summary

Chrysler (FCA US, LLC) is recalling certain 2022-2024 Jeep Wagoneer and Grand Wagoneer vehicles. The third-row seat belts may not allow occupants to properly access or fasten the seat belt to the buckle. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 208, "Occupant Crash Protection" and 209, "Seat Belt Assemblies."

### Remedy

Dealers will inspect and replace the third-row seat belt buckle, as necessary, free of charge. Owner notification letters are expected to be mailed December 15, 2023. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is A7A.

### Vehicles

---

MAKE	MODEL	YEAR
JEEP	GRAND WAGONEER	2022-2024
JEEP	WAGONEER	2022-2024

---

## Multiple Camera Images May Not Display/FMVSS 111

A camera that does not display an image can reduce the driver's view, increasing the risk of a crash or injury.

**NHTSA Campaign Number:** 23V718000

**Manufacturer** Mazda North American Operations

**Components** BACK OVER PREVENTION, FORWARD COLLISION AVOIDANCE, LANE DEPARTURE

**Potential Number of Units Affected** 11,903

### Summary

Mazda North American Operations (Mazda) is recalling certain 2024 CX-90 and MAZDA3 vehicles. Due to a software error, the rearview, front, and/or side camera images may not appear on the display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

### Remedy

Dealers will update the view monitor control module software, free of charge. Owner notification letters are expected to be mailed December 22, 2023. Owners may contact Mazda customer service at 1-800-222-5500 Option 6. Mazda's number for this recall is 6223J.

### Vehicles

MAKE	MODEL	YEAR
MAZDA	CX-90	2024
MAZDA	MAZDA3	2024

## Unintended Movement Due to Damaged Park Mechanism

Unintended vehicle movement can increase the risk of a crash.

**NHTSA Campaign Number:** 23V724000

**Manufacturer** Kia America, Inc.

**Components** POWER TRAIN, ELECTRICAL SYSTEM

**Potential Number of Units Affected** 6,262

### Summary

Kia America, Inc. (KIA) is recalling certain 2015-2019 Soul EV vehicles. The parking mechanism may be damaged, which can result in unintended vehicle movement when the gear shift lever is in the Park 'P' position and the parking brake is not applied while the vehicle is powered on.

### Remedy

Dealers will update the electronic control unit software, free of charge. Owner notification letters are expected to be mailed December 22, 2023. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC287. This recall expands and replaces recall number 20V-389. Vehicles previously repaired under 20V-389 will need to have the new remedy completed.

## Vehicle

---

MAKE	MODEL	YEAR
KIA	SOUL EV	2015-2019

---

## Rearview Camera Image May Not Display

Loss of the rearview camera image can reduce the driver's rear visibility, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V729000

**Manufacturer** Chinook Motor Coach, LLC

**Components** BACK OVER PREVENTION

**Potential Number of Units Affected** 73

### Summary

Chinook Motor Coach, LLC. (Chinook) is recalling certain 2022-2024 Bayside motorhomes. The rearview camera, or 360-degree view camera if equipped, may not display a rearview image when the vehicle is placed in reverse.

### Remedy

Dealers will replace the rearview camera, and update the software and wiring as necessary, free of charge. Owner notification letters are expected to be mailed November 22, 2023. Owners may contact Chinook customer service at 1-574-584-3756.

## Vehicle

---

MAKE	MODEL	YEAR
CHINOOK	BAYSIDE	2022-2024

---

## Engine & Electric Motor May Shut Down Unexpectedly

A loss of drive power can increase the risk of a crash.

**NHTSA Campaign Number:** 23V719000

**Manufacturer** Mazda North American Operations

**Components** POWER TRAIN

**Potential Number of Units Affected** 4,252

## Summary

Mazda North American Operations (Mazda) is recalling certain 2024 CX-90 plug-in hybrid electric (PHEV) vehicles. Due to a software error, the engine and electric motor may shut down unexpectedly, which can result in a loss of drive power.

## Remedy

Dealers will update the powertrain control module and engine control module software, free of charge. Owner notification letters are expected to be mailed December 22, 2023. Owners may contact Mazda customer service at 1-800-222-5500 Option 6. Mazda's number for this recall is 6323J.

## Vehicle

---

MAKE	MODEL	YEAR
MAZDA	CX-90	2024

---

## Front Bumper Assembly May Detach

A detached front bumper cover can become a road hazard, increasing the risk of a crash.

**NHTSA Campaign Number:** 23V720000

**Manufacturer** Toyota Motor Engineering & Manufacturing

**Components** STRUCTURE

**Potential Number of Units Affected** 750,795

## Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2020-2023 Highlander & Highlander Hybrid vehicles. During normal vehicle operation, minor impact to the front lower bumper cover may result in the cover coming loose or detaching.

## Remedy

Dealers will repair or replace the upper and lower front bumper covers as necessary, free of charge. Owner notification letters are expected to be mailed December 11, 2023. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 23TB12/23TA12.

## Vehicles

---

MAKE	MODEL	YEAR
TOYOTA	HIGHLANDER	2020-2023

---

---

MAKE

MODEL

YEAR

TOYOTA

HIGHLANDER HYBRID

2020-2023

---