



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

November 27, 2023

Unsecured Seat Belt Pretensioners/FMVSS 208-210

A seat belt pretensioner missing a rivet will not properly restrain the occupant, increasing the risk of injury during a crash.

NHTSA Campaign Number: 23V782000

Manufacturer Honda (American Honda Motor Co.)

Components SEAT BELTS

Potential Number of Units Affected 303,770

Summary

Honda (American Honda Motor Co.) is recalling certain 2023-2024 Accord and HR-V vehicles. The front seat belt pretensioners may be missing the rivet that secures the quick connector and wire plate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 208, "Occupant Crash Protection," 209, "Seat Belt Assemblies," and 210, "Seat Belt Assembly Anchorages."

Remedy

Dealers will inspect and replace the seat belt pretensioner assemblies as necessary, free of charge. Owner notification letters are expected to be mailed January 8, 2024. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are MG7 and NG5.

Vehicles

MAKE	MODEL	YEAR
HONDA	ACCORD	2023-2024

MAKE	MODEL	YEAR
HONDA	HR-V	2023-2024

Inoperative Instrument Panel/FMVSS 101 & 105

An inoperative instrument panel cannot show critical safety information, such as the speedometer or warning lights, increasing the risk of a crash.

NHTSA Campaign Number: 23V771000

Manufacturer Jayco, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 134

Summary

Jayco, Inc. (Jayco) is recalling certain 2023-2024 Entegra Emblem, Vision, Vision XL, Jayco Alante, Precept, and Precept Prestige motorhomes. Corrosion in the Smart Data Link Connector (SDLC) may interfere with the Controller Area Network (CAN) communication, resulting in an inoperative instrument panel. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 101, "Control and Displays" and 105, "Hydraulic and Electric Brake Systems."

Remedy

Ford dealers will install a wire harness connector, and inspect and replace the SDLC module, as necessary, free of charge. Owner notification letters are expected to be mailed December 15, 2023. Owners may contact Jayco customer service at 1-800-283-8267.

Vehicles

MAKE	MODEL	YEAR
ENTEGRA	EMBLEM	2023-2024
ENTEGRA	VISION	2023-2024
ENTEGRA	VISION XL	2023-2024
JAYCO	ALANTE	2023-2024

MAKE	MODEL	YEAR
JAYCO	PRECEPT	2023-2024
JAYCO	PRECEPT PRESTIGE	2023-2024

Delayed Braking Response from ABS Software

Delayed braking can extend the distance required to stop, increasing the risk of a crash.

NHTSA Campaign Number: 23V779000
Manufacturer CFMOTO POWERSPORTS, INC.
Components SERVICE BRAKES, AIR
Potential Number of Units Affected 1,374

Summary

CFMOTO POWERSPORTS, INC. (CFMOTO) is recalling certain 2022-2023 700CL-X motorcycles. The ABS control module software settings may delay braking when the hand brake lever is squeezed two or more times, and therefore lengthen the distance required to stop the motorcycle.

Remedy

Dealers will update the ABS software, free of charge. Owner notification letters are expected to be mailed November 27, 2023. Owners may contact CFMOTO customer service Toll Free at (888) 8-CFMOTO (283-6686) or at 1-763-398-2690; or via email at info@cfmotousa.com. CFMOTO's number for this recall is WAR-2023-07 and is available online at www.cfmotousa.com.

Vehicle

MAKE	MODEL	YEAR
CFMOTO	700 CL-X	2022-2023

Inadequate Attachment of Side Bench/FMVSS 207, 210

The attachment points may fail, allowing the bench seat to shift and increasing the risk of injury during a crash.

NHTSA Campaign Number: 23V769000

Manufacturer Volvo Trucks North America

Components SEATS

Potential Number of Units Affected 638

Summary

Volvo Trucks North America (Volvo Trucks) is recalling certain 2018-2024 VN, VNR, and VHD vehicles. The passenger side bench seat may be inadequately attached to the floor. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 207, "Seating Systems" and 210, "Seatbelt Assembly Anchorage."

Remedy

Dealers will replace the weld nut with two nuts and a washer, free of charge. Owner notification letters are expected to be mailed December 15, 2023. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Trucks number for this recall is RVXX2312.

Vehicles

MAKE	MODEL	YEAR
VOLVO	VHD	2018-2024
VOLVO	VN	2018-2024
VOLVO	VNR	2018-2024

Blank Instrument Panel Display

A blank instrument panel will not show critical information, such as vehicle speed and warning lights, increasing the risk of a crash.

NHTSA Campaign Number: 23V744000

Manufacturer General Motors, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 60,154

Summary

General Motors, LLC (GM) is recalling certain 2024 Buick Encore GX, Envista, and Chevrolet Trax vehicles. The software in the Virtual Cockpit Unit Module (VCU) may cause the instrument panel display to intermittently go blank at vehicle startup or while driving.

Remedy

The VCU software will be updated by a dealer or through an over-the-air (OTA) update, free of charge. Owner notification letters are expected to be mailed December 22, 2023. Owners may contact Buick customer

service at 1-800-521-7300 or Chevrolet customer service at 1-800-222-1020. GM's number for this recall is A232424320.

Vehicles

MAKE	MODEL	YEAR
BUICK	ENCORE GX	2024
BUICK	ENVISTA	2024
CHEVROLET	TRAX	2024
