



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

February 12, 2024

Air Bag May Deploy Unintentionally During a Crash

An air bag that deploys unintentionally during a crash can increase the risk of injury.

NHTSA Campaign Number: 24V064000

Manufacturer Honda (American Honda Motor Co.)

Components AIR BAGS

Potential Number of Units Affected 750,114

Summary

Honda (American Honda Motor Co.) is recalling certain 2020-2022 Pilot, Accord, Civic sedan, HR-V, Odyssey, 2020 Civic coupe, Fit, 2021-2022 Civic hatchback, 2021 Civic Type R, Insight, 2020-2021 CR-V, CR-V Hybrid, Passport, Ridgeline, Accord Hybrid, 2020 Acura MDX, 2022 Acura MDX, 2020-2022 Acura RDX, and 2020-2021 Acura TLX vehicles. The front passenger seat weight sensor may crack and short circuit, failing to suppress the air bag as intended.

Remedy

Dealers will replace the seat weight sensors, free of charge. Owner notification letters are expected to be mailed March 18, 2024. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for these recalls are XHP and VHQ.

Vehicles

MAKE	MODEL	YEAR
ACURA	MDX	2020, 2022

MAKE	MODEL	YEAR
ACURA	RDX	2020-2022
ACURA	TLX	2020-2021
HONDA	ACCORD	2020-2022
HONDA	ACCORD HYBRID	2020-2021
HONDA	CIVIC	2020-2022
HONDA	CIVIC TYPE-R	2021
HONDA	CR-V	2020-2021
HONDA	CR-V HYBRID	2020-2021
HONDA	FIT	2020
HONDA	HR-V	2020-2022
HONDA	INSIGHT	2021
HONDA	ODYSSEY	2020-2022
HONDA	PASSPORT	2020-2021
HONDA	PILOT	2020-2022

MAKE	MODEL	YEAR
HONDA	RIDGELINE	2020-2021

Loss of Power Steering Assist

A sudden loss of power steering assist can increase the risk of a crash.

NHTSA Campaign Number: 24V052000

Manufacturer Shyft Group

Components STEERING

Potential Number of Units Affected 797

Summary

Shyft Group is recalling certain 2023-2025 Spartan RV K2, K3, and K4 chassis. The steering gear may have foreign material inside the gear that could build pressure within the system, resulting in a loss of power steering assist.

Remedy

Shyft Group will remove and replace the steering gear, free of charge. Owner notification letters are expected to be mailed March 29, 2024. Owners may contact Shyft Group customer service at 1-800-237-7806. Shyft Group's number for this recall is 24-01.

Vehicles

MAKE	MODEL	YEAR
SPARTAN	K2	2023-2025
SPARTAN	K3	2023-2025
SPARTAN	K4	2023-2025

Tailgate May Open While Driving

An unlatched tailgate may open while driving and result in a loss of unsecured cargo, creating a road hazard and increasing the risk of a crash.

NHTSA Campaign Number: 24V060000

Manufacturer General Motors, LLC

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 323,232

Summary

General Motors, LLC (GM) is recalling certain 2020-2024 Chevrolet Silverado 2500, 3500, GMC Sierra 2500 and 3500 vehicles equipped with power-unlatching tailgates. The tailgate's electronic gate-release switch may short circuit due to water intrusion, which can result in the tailgate inadvertently unlatching while the vehicle is in park.

Remedy

Owners are advised to check that the tailgate is closed and latched before driving. Dealers will replace the exterior touchpad switch assemblies, free of charge. Owner notification letters are expected to be mailed March 18, 2024. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is N232426400.

Vehicles

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 2500	2020-2024
CHEVROLET	SILVERADO 3500	2020-2024
GMC	SIERRA 2500	2020-2024
GMC	SIERRA 3500	2020-2024

Loss of Drive Power from Faulty Driveshaft

A loss of drive power increases the risk of a crash.

NHTSA Campaign Number: 24V065000

Manufacturer Hyundai Motor America

Components POWER TRAIN

Potential Number of Units Affected 1,165

Summary

Hyundai Motor America (Hyundai) is recalling certain 2023 IONIQ 5, IONIQ 6, and Genesis GV60 vehicles. The rear inner driveshaft may have been improperly heat-treated, allowing it to break under load and resulting in a loss of drive power.

Remedy

Dealers will replace the rear inner driveshaft, free of charge. Owner notification letters are expected to be mailed March 25, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's numbers for this recall are 253(H), 017G(G).

Vehicles

MAKE	MODEL	YEAR
GENESIS	GV60	2023
HYUNDAI	IONIQ 5	2023
HYUNDAI	IONIQ 6	2023

Steering Gear Assembled Incorrectly

A loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V080000

Manufacturer Autocar, LLC

Components STEERING

Potential Number of Units Affected 36

Summary

Autocar, LLC (Autocar) is recalling certain 2023 ACX (Xpeditor) and ACTT (Xspotter) vehicles. The steering gear assemblies may have been assembled incorrectly with fewer recirculating balls than are required, which may result in a loss of steering control.

Remedy

Dealers will inspect and replace the steering gears as necessary, free of charge. Owner notification letters are expected to be mailed April 4, 2024. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's numbers for this recall are ACX-2401 and ACTT-2401.

Vehicles

MAKE	MODEL	YEAR
AUTOCAR	XPEDITOR	2023
AUTOCAR	XSPOTTER	2023

Engine May Shut Down Unexpectedly

A loss of drive power can increase the risk of a crash.

NHTSA Campaign Number: 24V072000

Manufacturer Mitsubishi Fuso Truck of America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 175

Summary

Mitsubishi Fuso Truck of America, Inc. (MFTA) is recalling certain 2024 FEC7K and FEC9K vehicles. Due to a control unit counter error, the vehicle may shut down unexpectedly, which can result in a loss of drive power.

Remedy

The remedy is currently under development. None of the affected vehicles have been sold, so therefore no owner notification letters will be sent. Owners may contact MFTA customer service at 1-877-771-0707. MFTA's number for this recall is C10126.

Vehicles

MAKE	MODEL	YEAR
mitsubishi fuso	FEC7K	2024
mitsubishi fuso	FEC9K	2024

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera that does not properly display an image can reduce the driver's rear view, increasing the risk of a crash.

NHTSA Campaign Number: 24V071000

Manufacturer Nissan North America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 57,914

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2018-2022 LEAF vehicles. Damage to the camera harness can cause distortion or loss of the rearview camera display image. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed March 20, 2024. Owners may contact Nissan customer service at 1-800-867-7669.

Vehicle

MAKE	MODEL	YEAR
NISSAN	LEAF	2018-2022
