



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

February 19, 2024

### Seat Belt Bezel May Damage or Tear Belt in a Crash

A torn or damaged seat belt may not properly restrain an occupant in a crash, increasing the risk of injury.

**NHTSA Campaign Number:** 24V087000

**Manufacturer** General Motors, LLC

**Components** SEAT BELTS

**Potential Number of Units Affected** 352

#### Summary

General Motors (GM) is recalling certain 2024 Chevrolet Silverado EV vehicles. An incorrect seat belt bezel on the second-row center seat belt may damage or tear the seat belt in the event of a crash.

#### Remedy

Dealers will replace the second-row center seat belt bezel, free of charge. Owner notification letters are expected to begin March 25, 2024. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N242430730.

#### Vehicle

---

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO EV	2024

---

## Software Error May Cause a Loss of Drive Power

A sudden loss of drive power increases the risk of a crash.

**NHTSA Campaign Number:** 24V076000

**Manufacturer** Lucid USA, Inc.

**Components** FORWARD COLLISION AVOIDANCE

**Potential Number of Units Affected** 189

### Summary

Lucid USA, Inc. (Lucid) is recalling certain 2022-2024 Air vehicles running software release versions 2.1.2 through 2.1.26. The software may cause a fault while the adaptive cruise control is on, resulting in a loss of drive power.

### Remedy

Lucid released an over-the-air (OTA) software update in October 2023, free of charge. Owner notification letters are expected to be mailed March 8, 2024. Owners may contact Lucid customer service at 1-888-995-8243. Lucid's number for this recall is SR-24-02-0.

### Vehicle

---

MAKE	MODEL	YEAR
LUCID	AIR	2022-2024

---

## High-Voltage Battery May Overheat

A high-voltage battery that overheats increases the risk of a fire.

**NHTSA Campaign Number:** 24V085000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 21

### Summary

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2019-2020 Jaguar I-PACE vehicles previously repaired under recall number 23V-369. The high-voltage battery may overheat.

### Remedy

Owners are advised to park and charge their vehicle outside and away from structures until the recall repair is complete and for 30 days after the repair has been completed. The battery energy control module software will be updated by a dealer. Repairs will be performed free of charge. Owner notification letters are expected

to be mailed March 28, 2024. Owners may contact Jaguar's customer service at 1 -800-452-4827. Jaguar's number for this recall is H471. These vehicles were previously recalled for this same issue under recall number 23V-369 and will need to have the new remedy performed.

## Vehicle

---

MAKE	MODEL	YEAR
JAGUAR	I-PACE	2019-2020

---

## Steering Gear Assembled Incorrectly

A loss of steering control increases the risk of a crash.

**NHTSA Campaign Number:** 24V088000

**Manufacturer** Navistar, Inc.

**Components** STEERING

**Potential Number of Units Affected** 893

### Summary

Navistar, Inc. (Navistar) is recalling certain 2024 International HX, LT, RH and 2024-2025 International HV, MV trucks and 2024 IC Bus CE commercial buses. The steering gear assemblies may have been assembled incorrectly with fewer recirculating balls than are required, which may result in a loss of steering control.

### Remedy

Dealers will inspect and replace the defective gears, free of charge. Owner notification letters are expected to be mailed March 18, 2024. Owners may contact Navistar's customer service at 1-800-448-7825. Navistar's number for this recall is 24503.

## Vehicles

---

MAKE	MODEL	YEAR
IC BUS	CECB	2024
INTERNATIONAL	HV	2024-2025
INTERNATIONAL	HX	2024

---

MAKE	MODEL	YEAR
INTERNATIONAL	LT	2024
INTERNATIONAL	MV	2024-2025
INTERNATIONAL	RH	2024

## Steering Gear Assembled Incorrectly

A loss of steering control increases the risk of a crash.

**NHTSA Campaign Number:** 24V089000

**Manufacturer** Navistar, Inc.

**Components** STEERING

**Potential Number of Units Affected** 1,191

### Summary

Navistar, Inc. (Navistar) is recalling certain 2024 IC Bus CE school buses. The steering gear assemblies may have been assembled incorrectly with fewer recirculating balls than are required, which may result in a loss of steering control.

### Remedy

Dealers will inspect and replace the defective gears, free of charge. Owner notification letters are expected to be mailed March 18, 2024. Owners may contact Navistar's customer service at 1-800-448-7825. Navistar's number for this recall is 24504.

### Vehicle

MAKE	MODEL	YEAR
IC BUS	CE SBUS	2024

## Steering Gear Assembled Incorrectly

A loss of steering control increases the risk of a crash.

**NHTSA Campaign Number:** 24V093000

**Manufacturer** Daimler Trucks North America, LLC

**Components** STEERING

**Potential Number of Units Affected** 11

### Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2024 FCCC MT45G, MT45, and Freightliner Cascadia vehicles. The steering gear assemblies may have been assembled incorrectly with fewer recirculating balls than are required, which may result in a loss of steering control.

### Remedy

Dealers will replace the steering gears, free of charge. Owner notification letters are expected to be mailed April 8, 2024. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for the recall is FL995.

### Vehicles

MAKE	MODEL	YEAR
FCCC	MT45	2024
FCCC	MT45G	2024
FREIGHTLINER	CASCADIA	2024

## Seat Belt Warning Chime May Not Activate/FMVSS 208

The driver may be unaware that their seat belt is not fastened, increasing the risk of injury during a crash.

**NHTSA Campaign Number:** 24V096000

**Manufacturer** Bugatti

**Components** SEAT BELTS, ELECTRICAL SYSTEM

**Potential Number of Units Affected** 156

### Summary

Bugatti is recalling certain 2016-2023 Bugatti Chiron vehicles. The audible chime may not activate when the vehicle starts, and the driver has not buckled their seat belt. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

## Remedy

Dealers will update the instrument cluster software, free of charge. Owner notification letters are expected to be mailed in February 2024. Owners may contact Bugatti customer service at 1-703-826-7545. Bugatti's number for this recall is BUGCR036.

## Vehicle

---

MAKE	MODEL	YEAR
BUGATTI	CHIRON	2016-2023

---

## Power Steering Pressure Line May Detach and Leak

A sudden loss of power steering fluid can result in a loss of power steering and power brake assist, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V097000

**Manufacturer** Ford Motor Company

**Components** STEERING, SERVICE BRAKES, HYDRAULIC

**Potential Number of Units Affected** 16,543

### Summary

Ford Motor Company (Ford) is recalling certain 2021-2022 E-350 and E-450 vehicles equipped with dual rear wheels. An inadequate connection between the power steering pressure line and the brake hydroboost unit may result in a sudden loss of power steering fluid.

### Remedy

Dealers will replace the power steering pressure line and the hydroboost jumper line, free of charge. Vehicles in this recall were previously recalled under 22V-089 and owners will need to have the new remedy completed even if their vehicle was remedied under the prior recall. Owner notification letters are expected to be mailed March 25, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24S07.

## Vehicles

---

MAKE	MODEL	YEAR
FORD	E-350	2021-2022
FORD	E-450	2021-2022

---

## Engine Valve Springs May Break

A loss of drive power increases the risk of a crash. A hole in the engine block increases the risk of a fire.

**NHTSA Campaign Number:** 24V106000

**Manufacturer** Hyundai Motor America

**Components** ENGINE AND ENGINE COOLING

**Potential Number of Units Affected** 4,245

### Summary

Hyundia Motor America (Hyundai) is recalling certain 2024 Palisade vehicles. The engine valve springs may break while driving, which can result in a loss of drive power and possibly create a hole in the engine block.

### Remedy

Dealers will replace the engine sub-assembly, free of charge. Owner notification letters are expected to be mailed April 13, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 255.

### Vehicle

MAKE	MODEL	YEAR
HYUNDAI	PALISADE	2024

## Water Damage to Starter Solenoid May Cause Fire

An engine compartment fire while parked or driving can increase the risk of injury.

**NHTSA Campaign Number:** 24V107000

**Manufacturer** Hyundai Motor America

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 90,907

### Summary

Hyundai Motor America (Hyundai) is recalling certain 2015-2016 Genesis, 2017-2019 Genesis G80, Genesis G90, and 2019 Genesis G70 vehicles. Water may enter the starter solenoid and cause an electrical short, which can result in an engine compartment fire while parked or driving.

### Remedy

Owners are advised to park outside and away from structures until the recall repair is complete. Dealers will install a remedy relay kit in the engine junction box, free of charge. Owner notification letters are expected to be mailed April 13, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's numbers for this recall are 254(H) and 018G(G).

## Vehicles

MAKE	MODEL	YEAR
GENESIS	G70	2019
GENESIS	G80	2017-2019
GENESIS	G90	2017-2019
HYUNDAI	GENESIS	2015-2016

## Inoperative Defrosting/Defogging System/FMVSS 103

An inoperative windshield defrosting and defogging system may decrease the driver's visibility, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V111000

**Manufacturer** Chrysler (FCA US, LLC)

**Components** VISIBILITY

**Potential Number of Units Affected** 199,143

### Summary

Chrysler (FCA US, LLC) is recalling certain 2021-2024 Jeep Wrangler and 2022-2024 Jeep Grand Cherokee vehicles. A hybrid control processor (HCP) software error may cause the defrosting and defogging system to be inoperative. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 103, "Windshield Defrosting and Defogging Systems."

### Remedy

Dealers will update the HCP software, free of charge. Owner notification letters are expected to be mailed April 5, 2024. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is 04B.

## Vehicles

MAKE	MODEL	YEAR
JEEP	GRAND CHEROKEE	2022-2024



---

MAKE

MODEL

YEAR

JEEP

WRANGLER

2021-2024

---