



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

March 18, 2024

Muted Pedestrian Warning Sound/FMVSS 141

Pedestrians may be unaware of an approaching vehicle if the PWS sounds are muted, increasing the risk of a crash.

NHTSA Campaign Number: 24V153000

Manufacturer Tesla, Inc.

Components FORWARD COLLISION AVOIDANCE, ELECTRICAL SYSTEM

Potential Number of Units Affected 6,557

Summary

Tesla, Inc. (Tesla) is recalling certain 2013, 2018-2021 Model S, 2020-2021 Model X, 2018-2022 Model 3, and 2020-2022 Model Y vehicles. A factory reset muted the Pedestrian Warning System (PWS) sounds. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 141, "Minimum Sound Requirements for Hybrid and Electric Vehicles."

Remedy

Tesla released an over-the-air (OTA) software update, release 2023.44.30.14, free of charge. Owner notification letters are expected to be mailed April 27, 2024. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-24-00-006.

Vehicles

MAKE	MODEL	YEAR
TESLA	MODEL 3	2018-2022

MAKE	MODEL	YEAR
TESLA	MODEL S	2013, 2018-2021
TESLA	MODEL X	2020-2021
TESLA	MODEL Y	2020-2022

Air Bag May Not Deploy Due to Clockspring Failure

An air bag that does not deploy in a crash can increase the risk of injury.

NHTSA Campaign Number: 24V196000

Manufacturer Chrysler (FCA US, LLC) (Stellantis)

Components AIR BAGS

Potential Number of Units Affected 1,831

Summary

Chrysler (FCA US, LLC) (Stellantis) is recalling certain right hand drive 2016 Jeep Wrangler vehicles. Debris contamination may cause the clockspring to fail, preventing the driver's air bag from deploying in a crash.

Remedy

Dealers will replace the clockspring, steering wheel back cover, and steering column shrouds, free of charge. Owner notification letters are expected to be mailed May 3, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is 27B.

Vehicle

MAKE	MODEL	YEAR
JEEP	WRANGLER	2016

Overloaded Electrical System May Cause Fire

Overloaded electrical circuits can overheat, increasing the risk of fire.

NHTSA Campaign Number: 24V194000

Manufacturer E-One Incorporated

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 22

Summary

E-One Incorporated (E-One) is recalling certain 2024 Commercial, Cyclone N, Typhoon N, and Typhoon EV vehicles equipped with Hercules HC 1.7 multiplex nodes. In the event of a short circuit or wiring failure, the firmware in the node may fail to shut off the output pin, resulting in overloaded electrical circuits.

Remedy

Weldon will update the firmware, free of charge. Owner notification letters are expected to be mailed April 1, 2024. Owners may contact E-One customer service at 1-352-237-1122.

Vehicles

MAKE	MODEL	YEAR
E-ONE	COMMERCIAL	2024
E-ONE	CYCLONE N	2024
E-ONE	TYPHOON	2024
E-ONE	TYPHOON N	2024

Engine Compartment Fire from Oil Leak

An oil leak in the presence of hot engine components can increase the risk of an engine compartment fire.

NHTSA Campaign Number: 24V191000

Manufacturer Hyundai Motor America

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 28,439

Summary

Hyundai Motor America (Hyundai) is recalling certain 2018-2020 Genesis G80, 2017-2022 G90, and 2019-2022 G70 vehicles equipped with a 3.3-liter V6 turbocharged engine. The left turbocharger oil feed pipe may deteriorate and leak oil.

Remedy

Dealers will replace the left turbocharger oil feed pipe, free of charge. Owner notification letters are expected to be mailed May 7, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 019G. This recall expands and replaces recall number 19V-538. Vehicles previously repaired under 19V-538 will need to have the new remedy completed.

Vehicles

MAKE	MODEL	YEAR
GENESIS	G70	2019-2022
GENESIS	G80	2018-2020
GENESIS	G90	2017-2022

Child Safety Lock Malfunction

A malfunctioning child safety lock that allows a rear door to be opened unintentionally can increase the risk of injury.

NHTSA Campaign Number: 24V189000

Manufacturer Ford Motor Company

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 9,847

Summary

Ford Motor Company (Ford) is recalling certain 2023-2024 Bronco 4-door vehicles. The left-side rear door may be opened from the inside of the vehicle when the child safety lock is in the "ON" position.

Remedy

Dealers will inspect the child safety locks and replace the rear door latch, as necessary, free of charge. Owner notification letters are expected to be mailed April 16, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24S15.

Vehicle

MAKE	MODEL	YEAR
FORD	BRONCO	2023-2024

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera that displays a blank or distorted image can reduce the drivers view of what is behind the vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 24V188000

Manufacturer Ford Motor Company

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,988

Summary

Ford Motor Company (Ford) is recalling certain 2020 Explorer vehicles. Due to a poor electrical connection, the rearview camera may intermittently display a blank or distorted image. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will replace the rearview camera, free of charge. Owner notification letters are expected to be mailed April 8, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20C19. This recall is an expansion of NHTSA recall number 20V-575.

Vehicle

MAKE	MODEL	YEAR
FORD	EXPLORER	2020

Incorrect Seat Belt Information on Label

Incorrect cargo carrying capacity information may result in an overloaded vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 24V186000

Manufacturer Forest River, Inc.

Components EQUIPMENT

Potential Number of Units Affected 50

Summary

Forest River, Inc. (Forest River) is recalling certain 2023-2024 Coachmen Prism PRC24MB motorhomes. The Federal Information label may indicate the incorrect number of seat belts installed, resulting in an incorrect cargo carrying capacity.

Remedy

Forest River will mail new labels, free of charge. Owner notification letters were mailed March 13, 2024. Owners may contact Forest River Customer Service at 1-574-825-8487. Forest River's number for this recall is 215-1747.

Vehicle

MAKE	MODEL	YEAR
COACHMEN	PRISM	2023-2024

Improperly Crimped Connectors In Gear Shifter

A loss of communication between the gear shifter and the transmission may result in the vehicle becoming disabled after coming to a stop, increasing the risk of a crash.

NHTSA Campaign Number: 24V190000

Manufacturer PACCAR Incorporated

Components POWER TRAIN

Potential Number of Units Affected 116,343

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2021-2024 Peterbilt 348, 365, 367, 389, 535, 536, 537, 548, 567, 579, Kenworth T180, T280, T380, T480, T880, W990, and 2021-2025 T680 trucks. The right-hand gear shifter stalk connectors may have been improperly crimped, resulting in a loss of communication.

Remedy

Dealers will inspect and replace the gear shifter assembly as necessary, free of charge. Owner notification letters are expected to be mailed May 7, 2024. Owners may contact Kenworth customer service at 1-425-828-5888 or Peterbilt customer service at 1-940-591-4220. PACCAR's numbers for this recall are 24PBE and 24KWE.

Vehicles

MAKE	MODEL	YEAR
KENWORTH	T180	2021-2024
KENWORTH	T280	2021-2024
KENWORTH	T380	2021-2024
KENWORTH	T480	2021-2024
KENWORTH	T680	2021-2025
KENWORTH	T880	2021-2024
KENWORTH	W990	2021-2024
PETERBILT	348	2021-2024
PETERBILT	365	2021-2024
PETERBILT	367	2021-2024
PETERBILT	389	2021-2024
PETERBILT	535	2021-2024
PETERBILT	536	2021-2024
PETERBILT	537	2021-2024

MAKE	MODEL	YEAR
PETERBILT	548	2021-2024
PETERBILT	567	2021-2024
PETERBILT	579	2021-2024

Improperly Secured Ball Joint in Steering Gearbox

A loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V184000

Manufacturer Honda (American Honda Motor Co.)

Components STEERING

Potential Number of Units Affected 245

Summary

Honda (American Honda Motor Co.) is recalling certain 2023 Passport and Ridgeline vehicles. The inner ball joint housing in the steering gearbox assembly may loosen and detach from the steering rack and result in a loss of steering control.

Remedy

Dealers will inspect and replace the steering gearbox as necessary, free of charge. Owner notification letters are expected to be mailed April 15, 2024. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is LHY.

Vehicles

MAKE	MODEL	YEAR
HONDA	PASSPORT	2023
HONDA	RIDGELINE	2023

High-Voltage Battery May Overheat

A high-voltage battery that overheats increases the risk of a fire.

NHTSA Campaign Number: 24V183000

Manufacturer Jaguar Land Rover North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 258

Summary

Jaguar Land Rover North America, LLC. (Jaguar) is recalling certain 2019 I-Pace vehicles. The high-voltage battery may overheat.

Remedy

The remedy is currently under development. Owners are advised to park and charge their vehicles outside and away from structures, and to only charge their vehicles to a maximum 75% state of charge until the recall repair is complete. Owner notification letters are expected to be mailed April 26, 2024. Owners may contact Jaguar's customer service at 1-800-452-4827. Jaguar's number for this recall is H484. These vehicles were previously recalled under 23V-369 and will need to have the new remedy completed.

Vehicle

MAKE	MODEL	YEAR
JAGUAR	I-PACE	2019

Overloaded Electrical System May Cause Fire

Overloaded electrical circuits can overheat, increasing the risk of fire.

NHTSA Campaign Number: 24V181000

Manufacturer Spartan Fire, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 42

Summary

Spartan Fire, LLC (Spartan Fire) is recalling certain 2023-2024 Gladiator, MetroStar, 2024 Commercial, FC-94, and KME Panther trucks equipped with Hercules HC 1.7 multiplex nodes. In the event of a short circuit or wiring failure, the firmware in the node may fail to shut off the output pin, resulting in overloaded electrical circuits.

Remedy

Weldon will update the firmware, free of charge. Owner notification letters are expected to be mailed April 8, 2024. Owners may contact Spartan Fire customer service at 1-517-543-6400. Spartan Fire's number for this recall is 24003.

Vehicles

MAKE	MODEL	YEAR
KME	PANTHER	2024
SPARTAN FIRE	COMMERCIAL	2024
SPARTAN FIRE	FC-94	2024
SPARTAN FIRE	GLADIATOR	2023-2024
SPARTAN FIRE	METROSTAR	2023-2024

Steering Gear Assembled Incorrectly

A loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V182000

Manufacturer Kalmar Solutions, LLC

Components STEERING

Potential Number of Units Affected 2

Summary

Kalmar Solutions, LLC (Kalmar) is recalling certain 2023 Ottawa T2 vehicles. The steering gear assemblies may have been assembled incorrectly with fewer recirculating balls than are required, which may result in a loss of steering control.

Remedy

Dealers will replace the defective gears, free of charge. Owner notification letters are expected to be mailed March 21, 2024. Owners may contact Kalmar customer service at 1-785-229-6327.

Vehicle

MAKE	MODEL	YEAR
KALMAR	OTTAWA T2	2023

Steering Column May Fail

A loss of steering control increases the risk of a crash.

NHTSA Campaign Number: 24V178000

Manufacturer Prevost Car (US) Inc.

Components STEERING

Potential Number of Units Affected 23

Summary

Prevost Car (US) Inc. (Prevost) is recalling certain 2023 H3-45 and 2022-2023 H3-45 VIP vehicles. The steering column joints may fail, causing a loss of steering control.

Remedy

Owners are advised not to drive their vehicle until the repair has been performed. Prevost will replace the steering column joints, free of charge. Owner notification letters are expected to be mailed April 19, 2024. Owners may contact Prevost customer service at 1-866-870-2046. Prevost's number for this recall is SR24-11.

Vehicles

MAKE	MODEL	YEAR
PREVOST	H3-45	2023
PREVOST	H3-45 VIP	2022-2023
