



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

August 12, 2024

Seat May Not Lock into Upright Position//FMVSS 207

A seat back that is not locked into position can increase the risk of injury in a crash.

NHTSA Campaign Number: 24V574000

Manufacturer Chrysler (FCA US, LLC)

Components SEATS

Potential Number of Units Affected 898

Summary

Chrysler (FCA US, LLC) is recalling certain 2023 Dodge Charger vehicles. The left rear seat back may not lock in the upright position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 207, "Seating Systems."

Remedy

Dealers will inspect and adjust the seat back latch striker as necessary, free of charge. Owner notification letters are expected to be mailed August 15, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is 37B.

Vehicle

MAKE	MODEL	YEAR
DODGE	CHARGER	2023

Seat May Not Lock into Upright Position//FMVSS 207

A seat back that is not locked into position can increase the risk of injury in a crash.

NHTSA Campaign Number: 24V573000

Manufacturer Chrysler (FCA US, LLC)

Components SEATS

Potential Number of Units Affected 2,852

Summary

Chrysler (FCA US, LLC) is recalling certain 2023 Dodge Challenger vehicles. The left rear seat back may not lock in the upright position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 207, "Seating Systems."

Remedy

Dealers will inspect and adjust the seat back latch striker as necessary, free of charge. Owner notification letters are expected to be mailed August 15, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is 38B.

Vehicle

MAKE	MODEL	YEAR
DODGE	CHALLENGER	2023

Starter Motor May Fail and Overheat

A starter motor that overheats can ignite nearby combustible material in the engine compartment, increasing the risk of a fire.

NHTSA Campaign Number: 24V576000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM, ENGINE AND ENGINE COOLING

Potential Number of Units Affected 105,588

Summary

BMW of North America, LLC is recalling certain 2019-2020 X5, X7, 2020 3 Series Sedan, X6, 2020-2021 7 Series Sedan, 2020 8 Series Convertible, 8 Series Coupe, and 2020 8 Series Gran Coupe vehicles. Please see the recall report for the complete list of models. In the event the starter motor fails, repeated attempts to start the vehicle can cause the starter motor to overheat from an electrical overload.

Remedy

Dealers will update the vehicle software, free of charge. Owner notification letters are expected to be mailed September 23, 2024. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE	MODEL	YEAR
BMW	340XI	2020
BMW	740I	2020-2021
BMW	740XI	2020-2021
BMW	840I	2020
BMW	840XI	2020
BMW	M340I	2020
BMW	M340XI	2020
BMW	X5	2019-2020
BMW	X6	2020
BMW	X7	2019-2020

Unsecured Air Bag Control Unit

An unsecured ACU can prevent or delay air bags from deploying as intended, increasing the risk of injury in a crash.

NHTSA Campaign Number: 24V580000

Manufacturer Nissan North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 7

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2021 and 2024 Titan vehicles. The Air Bag Control Unit (ACU) may be missing a spacer, which can allow the fastener to loosen and result in an unsecured ACU.

Remedy

Dealers will replace the ACU, free of charge. Owner notification letters are expected to be mailed September 19, 2024. Owners may contact Nissan customer service at 1-800-867-7669. Nissan's number for this recall is PD120.

Vehicle

MAKE	MODEL	YEAR
NISSAN	TITAN	2021, 2024

Loss of Steering Control from Tie Rod Failure

Tie rod failure can cause a loss of vehicle steering control and increase the risk of a crash.

NHTSA Campaign Number: 24V571000

Manufacturer Daimler Trucks North America, LLC

Components STEERING

Potential Number of Units Affected 3,421

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2025 Freightliner 108SD, 114SD, Business Class M2, Cascadia and Western Star 47X vehicles. The tie rod in the front axle may contain ball studs that have been incorrectly heat-treated, which can cause them to break, and result in tie rod failure.

Remedy

Dealers will replace the tie rod assembly, free of charge. Owner notification letters are expected to be mailed September 29, 2024. Owners may contact DTNA customer service at 800-745-8000. DTNA's number for this recall is F1007.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	108SD	2025

MAKE	MODEL	YEAR
FREIGHTLINER	114SD	2025
FREIGHTLINER	BUSINESS CLASS M2	2025
FREIGHTLINER	CASCADIA	2025
WESTERN STAR	47X	2025

Loss of Drive Power

A loss of drive power increases the risk of a crash.

NHTSA Campaign Number: 24V572000

Manufacturer Chrysler (FCA US, LLC)

Components POWER TRAIN

Potential Number of Units Affected 94

Summary

Chrysler (FCA US, LLC) is recalling certain 2021 Jeep Wrangler and Jeep Gladiator vehicles that were previously remedied under NHTSA recall number 23V-116. The software for the powertrain control module may cause an engine stall, which can result in a loss of drive power.

Remedy

Dealers will update the powertrain control module software, free of charge. Owner notification letters are expected to be mailed August 15, 2024. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is 92B. Vehicles previously repaired under recall 23V-116 will need to have the new remedy completed.

Vehicles

MAKE	MODEL	YEAR
JEEP	GLADIATOR	2021
JEEP	WRANGLER	2021

Brake Lights Flash During Braking/FMVSS 108

Flashing brake lights may cause confusion for other drivers on the road, increasing the risk of a crash.

NHTSA Campaign Number: 24V583000

Manufacturer Hyundai Motor America

Components EXTERIOR LIGHTING

Potential Number of Units Affected 38,331

Summary

Hyundai Motor America (Hyundai) is recalling certain 2024 Hyundai Sonata vehicles. The software for the brake lights may cause the brake lights to flash and not illuminate properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will update the rear brake light software, free of charge. Owner notification letters are expected to be mailed October 5, 2024. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 267.

Vehicle

MAKE	MODEL	YEAR
HYUNDAI	SONATA	2024

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera image that does not display decreases the driver's visibility, increasing the risk of a crash.

NHTSA Campaign Number: 24V584000

Manufacturer Hyundai Motor America

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,488

Summary

Hyundai Motor America (Hyundai) is recalling certain Genesis 2024-2025 GV60 hybrid and 2025 GV80 vehicles. The rearview camera display may shut off when the vehicle is driven in reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the rearview camera software, free of charge. Owner notification letters are expected to be mailed October 5, 2024. Owners may contact Genesis Customer service at 1-844-340-9741. Hyundai's number for this recall is 024G.

Vehicles

MAKE	MODEL	YEAR
GENESIS	GV60	2024-2025
GENESIS	GV80	2025
