



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

### September 23, 2024

#### Inoperative Low Brake Fluid Warning/FMVSS 135

**NHTSA Campaign Number:** 24V674000

**Manufacturer** General Motors, LLC

**Components** SERVICE BRAKES, HYDRAULIC

**Potential Number of Units Affected** 449,671

#### Summary

General Motors, LLC (GM) is recalling certain 2023 Chevrolet Silverado 1500, GMC Sierra 1500, 2023-2024 Chevrolet Tahoe, Suburban, GMC Yukon, Yukon XL, Cadillac Escalade, and Escalade ESV vehicles. The electronic brake control module software may fail to display a warning light when a loss of brake fluid occurs. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 135, "Light Vehicle Brake Systems."

#### Remedy

The Electronic Brake Control Module (eBCM) software will be updated through an over-the-air (OTA) update or by a dealer, free of charge. Owner notification letters are expected to be mailed October 28, 2024. Owners can contact GMC customer service at 1-800-462-8782, Chevrolet customer service at 1-800-222-1020, or Cadillac customer service at 1-800-458-8006. GM's number for this recall is N242447990.

#### Vehicles

---

MAKE	MODEL	YEAR
CADILLAC	ESCALADE	2023-2024

---

MAKE	MODEL	YEAR
CADILLAC	ESCALADE ESV	2023-2024
CHEVROLET	SILVERADO 1500	2023
CHEVROLET	SUBURBAN 1500	2023-2024
CHEVROLET	TAHOE	2023-2024
GMC	SIERRA 1500	2023
GMC	YUKON	2023-2024
GMC	YUKON XL	2023-2024

## Rearview Camera Image May Not Display

A rearview camera image that does not display can decrease the driver's visibility, increasing the risk of injury or crash.

**NHTSA Campaign Number:** 24V677000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** BACK OVER PREVENTION, FORWARD COLLISION AVOIDANCE

**Potential Number of Units Affected** 5

### Summary

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2024 F-Pace vehicles. The Near Field Sensing Module (NFSM) may overheat and cause the 3D surround camera images, including the rearview camera image, not to display.

### Remedy

Dealers will replace the NFSM module, free of charge. Owner notification letters are expected to be mailed October 25, 2024. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H516.

## Vehicle

MAKE	MODEL	YEAR
JAGUAR	F-PACE	2024

## Brake Lights May Fail to Illuminate

Brake lights that fail to illuminate can fail to indicate to other drivers that the vehicle is slowing down, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V668000

**Manufacturer** Daimler Trucks North America, LLC

**Components** FORWARD COLLISION AVOIDANCE, EXTERIOR LIGHTING

**Potential Number of Units Affected** 16,889

### Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2024-2025 Freightliner 108SD, 2022-2025 Freightliner 114SD, Freightliner Business Class M2, 2025 Freightliner eM2, 2020-2025 Western Star 49X, 2021-2025 Western Star 47X, and 2022-2025 Western Star 57X vehicles that may be upfitted with a body lighting interface controller and replacement brake lights. The brake lights may not illuminate when the brakes are automatically applied during an active brake assist (ABA) event.

### Remedy

Dealers will update the ABA software, free of charge. Owner notification letters are expected to be mailed November 9, 2024. Owners may contact DTNA customer service at 800-745-8000. DTNA's number for this recall is F1009.

## Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	108SD	2024-2025
FREIGHTLINER	114SD	2022-2025
FREIGHTLINER	BUSINESS CLASS M2	2022-2025

MAKE	MODEL	YEAR
FREIGHTLINER	EM2	2025
WESTERN STAR	47X	2021-2025
WESTERN STAR	49X	2020-2025
WESTERN STAR	57X	2022-2025

## Rearview Camera Image May Not Display

A rearview camera image that does not display can decrease the driver's visibility, increasing the risk of injury or crash.

**NHTSA Campaign Number:** 24V678000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** BACK OVER PREVENTION, FORWARD COLLISION AVOIDANCE

**Potential Number of Units Affected** 180

### Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2024 Defender, Discovery Sport, Range Rover, Range Rover Evoque, Range Rover Velar, and Range Rover Sport vehicles. The Near Field Sensing Module (NFSM) may overheat and cause the 3D surround camera images, including the rearview camera image, not to display.

### Remedy

Dealers will replace the NFSM, free of charge. Owner notification letters are expected to be mailed October 25, 2024. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N927.

### Vehicles

MAKE	MODEL	YEAR
LAND ROVER	DEFENDER	2024

MAKE	MODEL	YEAR
LAND ROVER	DISCOVERY SPORT	2024
LAND ROVER	RANGE ROVER	2024
LAND ROVER	RANGE ROVER EVOQUE	2024
LAND ROVER	RANGE ROVER SPORT	2024
LAND ROVER	RANGE ROVER VELAR	2024

## Rearview Camera Image May Freeze

An inoperative rearview camera display can reduce the driver's rear visibility, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V684000

**Manufacturer** Ford Motor Company

**Components** BACK OVER PREVENTION

**Potential Number of Units Affected** 144,516

### Summary

Ford Motor Company (Ford) is recalling certain 2022-2024 Ford Maverick vehicles equipped with Connected Touch Radios (CTR). The rearview camera image may freeze when the vehicle is in reverse.

### Remedy

Dealers will update the Connected Touch Radio (CTR) software, free of charge. Owner notification letters are expected to be mailed September 30, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24S59.

### Vehicle

MAKE	MODEL	YEAR
FORD	MAVERICK	2022-2024

## Remote Smart Parking Assist Failure

A remote smart parking assist feature that miscalculates stopping distances may increase the risk of a crash.

**NHTSA Campaign Number:** 24V693000

**Manufacturer** Kia America, Inc.

**Components** PARKING BRAKE

**Potential Number of Units Affected** 12,400

### Summary

Kia America, Inc. (Kia) is recalling certain 2024 EV9 vehicles. A software error may cause the remote smart parking assist feature, which allows the operator to remotely move the vehicle, to miscalculate stopping distances.

### Remedy

Dealers will update the integrated electronic brake software, free of charge. Owner notification letters are expected to be mailed October 18, 2024. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC324.

### Vehicle

---

MAKE	MODEL	YEAR
KIA	EV9	2024

---

## Latch May Allow Rear Door To Open While Driving

The rear door may appear closed even when the latch is not fully engaged, allowing the door to open while driving and increasing the risk of injury or a crash. Damaged latch components may prevent the rear door from being opened while inside the vehicle, increasing the risk of injury.

**NHTSA Campaign Number:** 24V659000

**Manufacturer** Mercedes-Benz USA, LLC

**Components** LATCHES/LOCKS/LINKAGES

**Potential Number of Units Affected** 134

### Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2019-2023 G 550 and 2019-2022 G63 AMG vehicles that received a replacement door latch during a service visit or prior recall repair. Components within the right-side rear door latch may prevent the rear doors from latching or opening properly.

## Remedy

Dealers will replace the right-side rear door latches, free of charge. Owner notification letters are expected to be mailed October 4, 2024. Owners may contact MBUSA customer service at 1-800-367-6372. Vehicles in this recall that were previously repaired under recall 21V-353 will need to have the new remedy completed.

## Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG G63	2019-2022
MERCEDES-BENZ	G 550	2019-2023

## Parking Lights May Flicker/FMVSS 108

Flickering parking lights can reduce visibility, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V682000

**Manufacturer** Ford Motor Company

**Components** EXTERIOR LIGHTING

**Potential Number of Units Affected** 16,543

### Summary

Ford Motor Company (Ford) is recalling certain 2022 F-150 vehicles. The parking lights may flicker when the headlights are activated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

## Remedy

Dealers will replace the LED Driver module, free of charge. Owner notification letters are expected to be mailed October 7, 2024. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 24C30. These vehicles were previously recalled for this same issue under 22V-686 and will need to have the new remedy performed.

## Vehicle

MAKE	MODEL	YEAR
FORD	F-150	2022

## Headlights May Flicker/FMVSS 108

Headlights flickering can reduce visibility, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V673000

**Manufacturer** General Motors, LLC

**Components** EXTERIOR LIGHTING

**Potential Number of Units Affected** 13,241

### Summary

General Motors, LLC (GM) is recalling certain 2024 GMC Canyon vehicles. The headlights may flicker while driving and while the vehicle is in park. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

### Remedy

Dealers will replace a module in the headlight, free of charge. Owner notification letters are expected to be mailed October 28, 2024. Owners can contact GMC customer service at 1-800-462-8782. GM's number for this recall is N242468880.

### Vehicle

---

MAKE	MODEL	YEAR
GMC	CANYON	2024

---

## SCCM Missing Cruise Control Markings/FMVSS 101

The driver may not know how to activate or deactivate the cruise control without the proper markings, increasing the risk of a crash.

**NHTSA Campaign Number:** 24V686000

**Manufacturer** Rivian Automotive, LLC

**Components** VEHICLE SPEED CONTROL, STEERING

**Potential Number of Units Affected** 33

### Summary

Rivian Automotive, LLC. (Rivian) is recalling certain 2025 R1S vehicles. The steering column control module (SCCM) may be missing cruise control markings. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays."

### Remedy



Rivian will inspect and replace the SCCMs as necessary, free of charge. Owner notification letters are expected to be mailed October 19, 2024. Owners may contact Rivian customer service at 1-888-748-4264. Rivian's number for this recall is FSAM-1532.

## Vehicle

---

MAKE	MODEL	YEAR
RIVIAN	R1S	2025

---