



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

December 2, 2024

Passenger Air Bag May Deploy Incorrectly

During air bag deployment, the dashboard panel may damage the air bag or cause the air bag to deploy improperly, increasing the risk of injury.

NHTSA Campaign Number: 24V891000

Manufacturer Pagani S.p.A

Components AIR BAGS

Potential Number of Units Affected 8

Summary

Pagani S.p.A (Pagani) is recalling certain 2024 Utopia vehicles. The passenger side dashboard panel may have been manufactured incorrectly, which can cause the air bag not to deploy as intended.

Remedy

Dealers will repair the dashboard panel by applying kevlar strips, free of charge. Owner notification letters are expected to be mailed December 9, 2024. Owners may contact Pagani S.p.A customer service at +39 059 4739201.

Vehicle

| MAKE | MODEL | YEAR |
|--------|--------|------|
| PAGANI | UTOPIA | 2024 |

Rearview Image May Not Display/FMVSS 111

An inoperative rearview camera display reduces the driver's rear visibility, increasing the risk of injury or crash.

NHTSA Campaign Number: 24V892000

Manufacturer Maserati North America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,710

Summary

Maserati North America, Inc. (Maserati) is recalling certain 2023-2024 Grecale and 2024 GranTurismo vehicles. The Central Vision Park Assist Module (CVPAM) software may prevent the rearview image from displaying when the vehicle is placed in reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the CVPAM software, free of charge. Owner notification letters are expected to be mailed January 10, 2025. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 761.

Vehicles

| MAKE | MODEL | YEAR |
|----------|-------------|-----------|
| MASERATI | GRANTURISMO | 2024 |
| MASERATI | GRECALE | 2023-2024 |

Rearview Image May Not Display/ FMVSS 111

A rearview image that does not display reduces the driver's visibility and increases the risk of a crash.

NHTSA Campaign Number: 24V879000

Manufacturer Hyundai Motor America

Components BACK OVER PREVENTION

Potential Number of Units Affected 226,118

Summary

Hyundai Motor America (Hyundai) is recalling certain 2021-2022 Santa Fe, Santa Fe HEV, Elantra, Elantra HEV and 2022 Elantra N and Santa Fe PHEV vehicles. Due to a damaged printed circuit board, the rearview camera image may fail to display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will replace the rearview camera, free of charge. Owner notification letters are expected to be mailed January 19, 2025. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 271.

Vehicles

| MAKE | MODEL | YEAR |
|---------|-------------------------|-----------|
| HYUNDAI | ELANTRA | 2021-2022 |
| HYUNDAI | ELANTRA HEV | 2021-2022 |
| HYUNDAI | ELANTRA N | 2022 |
| HYUNDAI | SANTA FE | 2021-2022 |
| HYUNDAI | SANTA FE HYBRID | 2021-2022 |
| HYUNDAI | SANTA FE PLUG-IN HYBRID | 2022 |

Front Seat Back Recliners Improperly Welded

The seat back frame may not properly restrain the occupant during a crash, increasing the risk of injury.

NHTSA Campaign Number: 24V886000

Manufacturer Tesla, Inc.

Components SEATS

Potential Number of Units Affected 27

Summary

Tesla, Inc. (Tesla) is recalling certain 2024 Model Y vehicles. The weld attaching the seat recliner mechanism to the front seat backs may fail.

Remedy

Tesla service will replace the seat assembly, free of charge. Owner notification letters are expected to be mailed January 21, 2025. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-24-13-004.

Vehicle

| MAKE | MODEL | YEAR |
|-------|---------|------|
| TESLA | MODEL Y | 2024 |

Engine Stall from Software Error

An engine stall or loss of power can increase the risk of a crash or injury.

NHTSA Campaign Number: 24V882000

Manufacturer Honda (American Honda Motor Co.)

Components FUEL SYSTEM, GASOLINE, ELECTRICAL SYSTEM

Potential Number of Units Affected 4,205

Summary

Honda (American Honda Motor Co.) is recalling certain 2022 and 2024-2025 CRF1100 Africa Twin motorcycles. A software error in the fuel injection electronic control unit (FI-ECU) may cause an engine stall or a loss of power when the Wheelie Control feature is activated.

Remedy

Dealers will reprogram the FI-ECU software, free of charge. Owner notification letters are expected to be mailed January 20, 2025. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KR1.

Vehicle

| MAKE | MODEL | YEAR |
|-------|---------|-----------------|
| HONDA | CRF1100 | 2022, 2024-2025 |

Steering Intermediate Shaft May Fracture

A steering shaft that detaches can result in a loss of steering control, increasing the risk of a crash.

NHTSA Campaign Number: 24V878000

Manufacturer Toyota Motor Engineering & Manufacturing

Components STEERING

Potential Number of Units Affected 8,057

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2023-2024 Corolla and Corolla Hybrid vehicles. Due to cracks developed during the manufacturing process, the steering intermediate shaft assembly may fracture and possibly result in the shaft detaching from the steering column.

Remedy

Dealers will replace the intermediate steering shaft, free of charge. Owner notification letters are expected to be mailed January 20, 2025. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 24TB13/24TA13.

Vehicles

| MAKE | MODEL | YEAR |
|--------|----------------|-----------|
| TOYOTA | COROLLA | 2023-2024 |
| TOYOTA | COROLLA HYBRID | 2023-2024 |

Glass Sunroof Panel May Detach

A detached sunroof panel can become a road hazard, increasing the risk of a crash.

NHTSA Campaign Number: 24V874000

Manufacturer Mercedes-Benz USA, LLC

Components VISIBILITY

Potential Number of Units Affected 33,456

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2001-2011 C-Class, CLK, E-Class, and CLS vehicles. Please see the recall report for a complete list of models and model years. The glass sunroof panel may not be properly secured and can detach.

Remedy

Dealers will inspect and replace the sunroof panel as necessary, free of charge. Owner notification letters are expected to be mailed January 18, 2025. Owners may contact MBUSA customer service at 1-800-367-6372. This recall is an expansion of previous NHTSA recall number 22V-954.

Vehicles

| MAKE | MODEL | YEAR |
|---------------|---------|-----------|
| MERCEDES BENZ | AMG E53 | 2007-2009 |
| MERCEDES BENZ | C230 | 2002-2007 |
| MERCEDES BENZ | C240 | 2001-2005 |
| MERCEDES BENZ | C280 | 2006-2007 |
| MERCEDES BENZ | C320 | 2001-2005 |
| MERCEDES BENZ | C350 | 2006-2007 |
| MERCEDES BENZ | CLK320 | 2003-2005 |
| MERCEDES BENZ | CLK350 | 2006-2009 |
| MERCEDES BENZ | CLK500 | 2003-2007 |
| MERCEDES BENZ | CLK550 | 2007-2009 |
| MERCEDES BENZ | CLS500 | 2006 |
| MERCEDES BENZ | CLS550 | 2007-2011 |

| MAKE | MODEL | YEAR |
|---------------|-----------|-----------|
| MERCEDES BENZ | E320 | 2003-2009 |
| MERCEDES BENZ | E500 | 2003-2006 |
| MERCEDES BENZ | E550 | 2007-2009 |
| MERCEDES-BENZ | AMG C32 | 2002-2004 |
| MERCEDES-BENZ | AMG C55 | 2005-2006 |
| MERCEDES-BENZ | AMG CLK55 | 2003-2005 |
| MERCEDES-BENZ | AMG CLS55 | 2006 |
| MERCEDES-BENZ | AMG CLS63 | 2007-2011 |
| MERCEDES-BENZ | AMG E55 | 2003-2006 |
| MERCEDES-BENZ | AMG E63 | 2007-2008 |
| MERCEDES-BENZ | E350 | 2006-2009 |
