



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

May 5, 2025

Blank or Distorted Rearview Camera Image

A blank or distorted rearview camera image can reduce the driver's view of what is behind the vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 25V270000

Manufacturer Ford Motor Company

Components BACK OVER PREVENTION

Potential Number of Units Affected 160,729

Summary

Ford Motor Company (Ford) is recalling certain 2015 F-250, F-350, F-450, Expedition, Lincoln Navigator, and MKC vehicles. The rearview camera printed circuit board terminal header connector may be loose or damaged, which can result in a blank or distorted image.

Remedy

Dealers will replace the rearview camera, free of charge. Owner notification letters are expected to be mailed on May 5, 2025. Owners may contact Ford Customer Service at 1-866-436-7332. Ford's number for this recall is 25S42. This recall expands previous recall number 22V-082.

Vehicles

MAKE	MODEL	YEAR
FORD	EXPEDITION	2015

MAKE	MODEL	YEAR
FORD	F-250	2015
FORD	F-350	2015
FORD	F-450	2015
LINCOLN	MKC	2015
LINCOLN	NAVIGATOR	2015

Rearview Camera Image May Not Display

Loss of the rearview camera image can reduce the driver's view of what is behind the vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 25V273000

Manufacturer Ford Motor Company

Components BACK OVER PREVENTION

Potential Number of Units Affected 128,889

Summary

Ford Motor Company (Ford) is recalling certain 2022-2023 Bronco vehicles. The 360-degree view camera may not display a rearview image when the vehicle is placed in reverse.

Remedy

Dealers will replace the rearview camera, free of charge. Owner notification letters are expected to be mailed on May 05, 2025. Owners may contact Ford Customer Service at 1-866-436-7332. Ford's number for this recall is 23S48. This recall expands previous recall number 23V-598.

Vehicle

MAKE	MODEL	YEAR
FORD	BRONCO	2022-2023

Rearview Camera Image May Not Display/FMVSS 111

A rearview camera image that does not display reduces the driver's view of what is behind the vehicle, increasing the risk of a crash.

NHTSA Campaign Number: 25V280000

Manufacturer Polestar Automotive USA, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 27,816

Summary

Polestar Automotive USA, Inc. (Polestar) is recalling certain 2021-2025 Polestar 2 vehicles. The rearview camera image may not display when the vehicle is placed in reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the vehicle software, free of charge. Owner notification letters are expected to be mailed June 19, 2025. Owners may contact Polestar's customer service at 1-800-806-2504. Polestar's number for this recall is RP1056. Vehicles in this recall that were previously repaired under 24V-477 will need to have the new remedy completed.

Vehicle

MAKE	MODEL	YEAR
POLESTAR	POLESTAR 2	2021-2025

Incorrect Seat Width on Rear Bench/FMVSS 208

In the event that more than two passengers sit in the rear bench seat, there would not be enough seat belts, increasing the risk of injury during a crash.

NHTSA Campaign Number: 25V269000

Manufacturer Volkswagen Group of America, Inc.

Components SEATS

Potential Number of Units Affected 5,637

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2025 ID. BUZZ vehicles. The third-row rear bench is wide enough for three passengers, but is designed for two passengers and equipped with two seat belts. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will install trim to adjust the width of the third-row rear seats, free of charge. Owner notification letters are expected to be mailed June 20, 2025. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 72LC.

Vehicle

MAKE	MODEL	YEAR
VOLKSWAGEN	ID. BUZZ	2025

Improperly Secured Battery May Cause Fire

Electrical arcing increases the risk of a fire. In addition, a loss of drive power may occur, which can increase the risk of a crash.

NHTSA Campaign Number: 25V272000

Manufacturer Ford Motor Company

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 3

Summary

Ford Motor Company (Ford) is recalling certain 2023 F-150 Lightning vehicles. The fasteners that secure the junction box bus bars inside the high-voltage battery pack may not have been tightened securely, which can cause electrical arcing at the busbars.

Remedy

Dealers will inspect and repair the busbar fasteners and replace any damaged components as necessary, free of charge. Owner notification letters are expected to be mailed on May 19, 2025. Owners may contact Ford Customer Service at 1-866-436-7332. Ford's number for this recall is 24S11. This recall expands previous recall number 24V-144.

Vehicle

MAKE	MODEL	YEAR
FORD	F-150 LIGHTNING BEV	2023

Engine Failure

Engine failure increases the risk of a crash.

NHTSA Campaign Number: 25V274000

Manufacturer General Motors, LLC

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 597,571

Summary

General Motors LLC (GM) is recalling certain 2021-2024 Cadillac Escalade and Escalade ESV, Chevrolet Silverado 1500, Suburban, and Tahoe, GMC Sierra 1500, Yukon, and Yukon XL vehicles equipped with a 6.2L V8 gas engine. The connecting rod and/or crankshaft engine components may have manufacturing defects that can lead to engine damage and engine failure.

Remedy

Dealers will inspect the engine, and as necessary, repair or replace the engine. For vehicles that pass inspection, dealers will add higher viscosity oil, install a new oil fill cap, replace the oil filter, and update the owner's manual. Repairs will be performed free of charge. Owner notification letters are expected to be mailed June 9, 2025. Owners may contact Cadillac customer service at 1-800-333-4223, Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is N252494000.

Vehicles

MAKE	MODEL	YEAR
CADILLAC	ESCALADE	2021-2024
CADILLAC	ESCALADE ESV	2021-2024
CHEVROLET	SILVERADO 1500	2021-2024
CHEVROLET	SUBURBAN	2021-2024
CHEVROLET	TAHOE	2021-2024
GMC	SIERRA 1500	2021-2024

MAKE	MODEL	YEAR
GMC	YUKON	2021-2024
GMC	YUKON XL	2021-2024

Windshield Wipers May Fail

Windshield wiper failure can reduce driver visibility, increasing the risk of a crash.

NHTSA Campaign Number: 25V276000

Manufacturer International Motors, LLC

Components VISIBILITY

Potential Number of Units Affected 14,786

Summary

International Motors, LLC (International) is recalling certain 2025-2026 HV, HX, LT, MV, and RH vehicles. The linkage that connects the right-side wiper arm to the motor may separate, causing the wipers to fail.

Remedy

Dealers will replace the wiper module, free of charge. Owner notification letters are expected to be mailed June 23, 2025. Owners may contact International customer service at 1-800-448-7825. International's number for this recall is 25505.

Vehicles

MAKE	MODEL	YEAR
INTERNATIONAL	HV	2025-2026
INTERNATIONAL	HX	2025-2026
INTERNATIONAL	LT	2025-2026
INTERNATIONAL	MV	2025-2026

MAKE	MODEL	YEAR
INTERNATIONAL	RH	2025-2026

Brakes May Engage Unexpectedly and Overheat

Brakes that overheat can increase the risk of a fire.

NHTSA Campaign Number: 25V279000

Manufacturer Temsa

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 594

Summary

Temsa is recalling certain 2021-2025 TS30, TS35, and 2021-2026 TS45 buses equipped with a Mux5-B multiplex. The temporary bus stop valve may activate unintentionally and apply the brakes, causing them to overheat.

Remedy

Temsa will inspect the multiplex, update the software, and repair the wiring harness as necessary, free of charge. Owner notification letters are expected to be mailed May 12, 2025. Owners may contact Temsa customer service at 1-833-628-3672.

Vehicles

MAKE	MODEL	YEAR
TEMSA	TS30	2021-2025
TEMSA	TS35	2021-2025
TEMSA	TS45	2021-2026
