



# Automotive Safety Council

Prevent

Protect

Notify

## NHTSA Recalls of Interest

May 26, 2025

### Improperly Connected Air Bag/FMVSS 208

A driver's side air bag that does not deploy as intended increases the risk of injury in a crash.

**NHTSA Campaign Number:** 25V298000

**Manufacturer** Chrysler (FCA US, LLC)

**Components** AIR BAGS, ELECTRICAL SYSTEM

**Potential Number of Units Affected** 71

#### Summary

Chrysler (FCA US, LLC) is recalling certain 2019-2024 Ram 1500 vehicles. The driver's side air bag may not be connected properly, which can cause the air bag not to deploy as intended. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

#### Remedy

Dealers secured the connectors for the air bag, free of charge. All vehicles have been remedied. Owners may contact Chrysler customer service at 800-853-1403. Chrysler's number for this recall is 08C.

#### Vehicle

MAKE	MODEL	YEAR
RAM	1500	2019-2024

# Improperly Welded Head Restraint

An improperly welded head restraint can result in an increased risk of injury to the seat occupant during a crash.

**NHTSA Campaign Number:** 25V299000

**Manufacturer** General Motors, LLC

**Components** SEATS

**Potential Number of Units Affected** 32

## Summary

General Motors LLC (GM) is recalling certain 2025 Chevrolet Express and GMC Savana vehicles. The front passenger seat head restraint may have been improperly welded to the seat frame.

## Remedy

Dealers will inspect and replace the front passenger seat frame, as necessary, free of charge. Owner notification letters are expected to be mailed June 23, 2025. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is N252503580.

## Vehicles

MAKE	MODEL	YEAR
CHEVROLET	EXPRESS	2025
GMC	SAVANA	2025

# Loss of Drive Power

A loss of drive power increases the risk of a crash.

**NHTSA Campaign Number:** 25V319000

**Manufacturer** Isuzu Motors Limited

**Components** ELECTRICAL SYSTEM

**Potential Number of Units Affected** 73

## Summary

Isuzu Motors Limited (Isuzu) is recalling certain 2025 NRR-EV vehicles. A gap between the bus bar and connection terminal may cause the system to overheat and turn off the drive motor.

Remedy

Dealers will replace the sub-junction box. Dealers will inspect and replace the harness and motor/inverter as necessary. All repairs will be performed free of charge. Owner notification letters are expected to be mailed July 8, 2025. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V2503.

Vehicle

MAKE	MODEL	YEAR
ISUZU	NRR EV	2025

Inaccurate Gear Selection Display/FMVSS 101

An inaccurate gear selection display may mislead the driver as to what gear is actually selected, leading to unexpected vehicle movement and increasing the risk of a crash.

NHTSA Campaign Number: 25V297000

Manufacturer Chrysler (FCA US, LLC)

Components POWER TRAIN, ELECTRICAL SYSTEM

Potential Number of Units Affected 778

Summary

Chrysler (FCA US, LLC) is recalling certain Ram 2500 and Ram 3500 vehicles equipped with a 3.5" cluster and column shifter. A software error may cause the gear selection display to be inaccurate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays."

Remedy

Dealers will update the cluster software, free of charge. Owner notification letters are expected to be mailed June 5, 2025. Owners may contact Chrysler customer service at 800-853-1403. Chrysler's number for this recall is 36C.

Vehicles

MAKE	MODEL	YEAR
RAM	2500	2025
RAM	3500	2025

# Front Lower Control Arm May Detach

## Do Not Drive Warning

A detached control arm can cause a loss of vehicle steering and control, increasing the risk of a crash.

**NHTSA Campaign Number:** 25V308000

**Manufacturer** Ford Motor Company

**Components** SUSPENSION

**Potential Number of Units Affected** 3

### Summary

Ford Motor Company (Ford) is recalling certain 2024-2025 Bronco vehicles. The front lower control arm fasteners may not have been tightened properly, allowing the control arm to detach from the frame.

### Remedy

Owners are advised not to drive their vehicles until they have been repaired. Dealers will inspect and verify that the lower control arm fasteners are tightened properly. If a fastener is loose or missing, the dealer will replace the fastener. Repairs will be performed free of charge. Owner notification letters are expected to be mailed May 19, 2025. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 25S48.

### Vehicle

MAKE	MODEL	YEAR
FORD	BRONCO	2024-2025

# Loss of Brake Function from Brake Fluid Leak

A loss of brake function increases the risk of a crash.

**NHTSA Campaign Number:** 25V314000

**Manufacturer** Ford Motor Company

**Components** SERVICE BRAKES, HYDRAULIC

**Potential Number of Units Affected** 273,789

### Summary

Ford Motor Company (Ford) is recalling certain 2022-2024 Navigator and Expedition vehicles. The front brake lines may contact the engine air cleaner outlet pipe and become damaged, possibly resulting in a brake fluid leak and reduced brake function.

Remedy

Dealers will inspect the front brake line and replace the brake line or air cleaner outlet pipe, as necessary, free of charge. Owner notification letters are expected to be mailed May 26, 2025. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 25S47.

Vehicles

MAKE	MODEL	YEAR
FORD	EXPEDITION	2022-2024
LINCOLN	NAVIGATOR	2022-2024